


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

**History of original corner establishment:**

This corner was originally set in error by PLS 1051 in 1978. This corner certificate is for the correct corner monument location which was established by PLS 1106 in 1987.

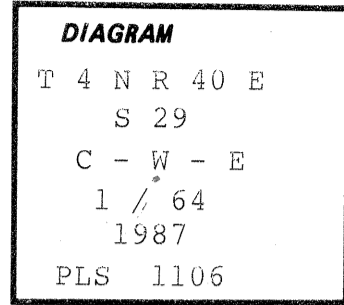

**Description of corner evidence found:**

A monument by PLS 1051 brs S85°05'E, 10.0'.

**Description of monument and accessories established to perpetuate the original location of this corner:**

At correct corner location...

Set 2½" x 30" aluminum pipe with 2½" aluminum cap 24" in ground and surrounded with a mound of earth and stone. Cap marked as shown in corner diagram.

New bearing trees established:

A 12" Western Larch brs S62½°W, 37.0' scribed C-W-E1/64S29 BT.

A 14" Western Larch brs N63°W, 88.6' scribed C-W-E1/64S29 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9 and painted face of blaze & 6" red band around each BT. Set steel fence post East & South of corner, attached sign 54-9 to one post and 54-2 to both posts.

Compass declination 19° East.

I hereby certify that the above corner monument was properly established to U.S.F.S. standards under my supervision on October 6, 1987.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

Office of County Surveyor..... County of Union.....

State of Oregon....., I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 19.....

..... by  
(COUNTY OFFICIAL)

(DEPUTY)

Form R6-7100-57 (9/71)

(REFER TO SURVEY  
1-88)

**UNION COUNTY  
SURVEYOR**  
Date Received 1-11-88  
GPO-791-311  
Date Filed 1-12-88  
By G. LANGLITZ, DEPUTY  
File No. NARRATIVE DRAWING 1/2