
W-3


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner not established in original survey

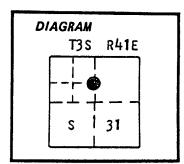

Description of corner evidence found: NONE

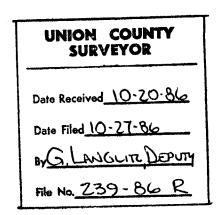

See map of survey number 30-86 filed in the office of the Union County Surveyor Description of monument and accessories I established to perpetuate the original location of this corner: At position determined by survey, I set a 2¹/₂ × 30¹¹ aluminum pipe with aluminum cap marked as shown, 28 inches in the ground, from which:

A 10 inch Douglas Fir bears N 1° E, 45.02 feet, marked CN 1/16 S31 BT.

A 13 inch Tamarack bears S 31° E, 47.03 feet, marked CN 1/16 S31 BT.

Set a steel fence post approximately 5 feet South with a 54-9 sign attached.

Corner set : 9/11/86 Witness: Greg Blackman, Rick Robinson



- ---

GRIFFITH BAGETY T3S R41E N 1/16 S 31 € 1986

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

Office of	County of
State of , I hereby certi for record on the day of	ify that the within instrument was filed in this office
(COUNTY OFFICIAL)	. by
	(DEPOIN)

Form R6-7100-57 (9/71)

☆U.S. GOVERNMENT PRINTING OFFICE - 1983 - 793 - 276

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original comer establishment: Corner originally established me on Union County survey number 30-86. My remonumentation record states:

At position determined by survey, I set a 2½"x30" aluminum pipe with aluminum cap marked as shown, (markings shown below) 28 inches in the ground, from which;

A 10 inch Douglas Fir bears N1°E, 45.02 feet, marked CN1/16 S31 BT A 13 inch Tamarack bears S31°E, 47.03 feet, marked CN1/16 S31 BT

Corner set: 9/11/86 Witness: Greg Blackman, Rick Robinson

Set a steel fencepost approximately 5 feet South with a 54-9 sign attached

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found the corner monument and accessories as stated above.

Due to an error in placing the proportioned South ½ corner of Section 31 on Union County Survey Number 29-86, I rebreak Section 31 and move the monument as per Union County Survey Number 24-88 The new ties to the accessories are shown below.


Description of monument and accessories I established to perpetuate the

original location of this corner: At position determined by Union County Survey Number 24-88, I reset the above described monument 28 inches in the ground, from which;

New ties to the existing bearing trees: A 10 inch diameter Douglas Fir bears N2°E, 45.02 feet marked CN1/16 S31 BT A 13 inch diameter Tamarack bears S32°E, 47.48 feet marked CN1/16 S31 BT

I hereby certify that the above corner point was perpetuated as hereon described on July 22, 1988.




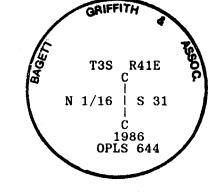

I used a steel tape and magnetic compass in the relocation of the existing accessories. I used 20° magnetic declination. The distances are to a 50d spike driven in the right side of the root crown.

Office of	County of
State of	reby certify that the within instrument was filed in this office
for record on the day of	
by	
(COUNTY OFFICIAL)	(DEPLITY)

Form R6-7100-57 (9/71)

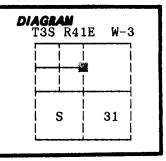

UNION COUNTY

SURVEYOR

Date Received 8-9-88

By G. LANGLITZ DENTY

90-88 R

Date Filed 8.24.88

File No.

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established on Union County survey number 30-86. Union County monumentation record 239-86R states: At position determined by survey, I set a 2 ½" x 30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground, from which: A 10" Douglas Fir bears N1°E, 45.02 feet, marked CN 1/16 S31 BT. A 13" Tamarack bears S31°E, 47.03 feet, marked CN 1/16 S31 BT. Set steel fencepost approx. 5 feet South

Corner re-established on Union County survey number 24-88. Union County monumentation record 90-88R states: Due to an error in placing the proportioned South 1/4 corner of Section 31, I rebreak Section 31 and move the monument as per survey. At position determined by survey, I reset the above described monument 28 inches in the ground, from which: A 10" Douglas Fir bears N2°E, 45.02 feet, marked CN 1/16 S31 BT. A 13" Tamarack bears S32°E, 47.48 feet, marked CN 1/16 S31 BT.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 2 $\frac{1}{2}$ " aluminum pipe, flush with ground, with $2\frac{1}{2}$ " aluminum cap marked as shown, from which:

A 10" Douglas Fir bears North 2° East, a dist. of 45 feet, dead, down, and heavily decayed with scribes visible. An 18" Tamarack bears S32°E, 47.48 feet, alive and vigorous with healed blaze.

Steel fencepost bears South 5'

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

From the aluminum pipe monument:


NEW BEARING OBJECTS:


A 7" Tamarack bears North 34° East a dist. of 11.65 ft., marked CN 1/16 S31 BT.

Fence corner from which fences run South and West bears approx. 2' North I hereby certify that the corner was perpetuated on August 8, 2019. Witness: Kyle A. Tuckcr



Renewal Date: June 30, 2019

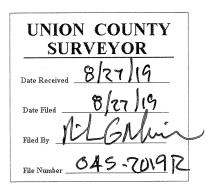

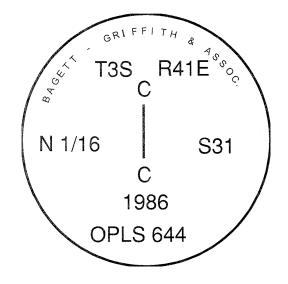

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

T3S R41EW-03

