CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:
Corner originally established by Rufus S. Moore under GLO contract number 382, dated March 23rd, 1881. GLO record states:
Set post for Cor. to Secs. 18 and 19, from which:
A Fir 10 in. diam. bears N75°E, 45 lks. dist.
An Alder 5 in. diam. bears N45°W, 24 lks. dist.
A Fir 18 in. diam. bears S31°E, 33 lks. dist.
A Bearberry 5 in. diam. bears S20°W, 23 lks. dist.

T 2 N R 39 E N-01

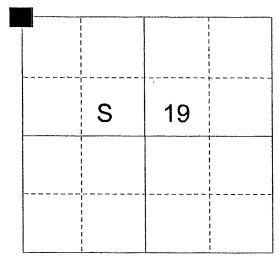

DESCRIPTION OF CORNER EVIDENCE FOUND:
None.

SEE SURVEY NUMBER 024-2013

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:
At proportionate position, I set a 5/8"x30" iron pin with 2 ½" aluminum cap, marked as shown below, 32 inches in the ground, from which:

A 5/8" x 30" iron pin bears North, a distance of 94.63 feet, with 1 ½" aluminum cap marked N RP 94.63.
A 4 inch Douglas Fir bears South 29° East, a distance of 33.25 feet, marked X BT.
A 5/8" x 30" iron pin bears South, a distance of 48.15 feet, with a 1 ½" aluminum cap marked S RP 48.15.
A 5/8" x 30" iron pin bears West, a distance of 10.00 feet, with a 1 ½" aluminum cap marked W RP 10.00.

Corner falls in the center of Gordon Creek Road.
I hereby certify that the corner was monumented on May 21, 2013.

REGISTERED
PROFESSIONAL
LAND SURVEYOR
OREGON
June 2, 2010
JEFFREY S. HSU
83571
Renewal Date: June 30, 2015

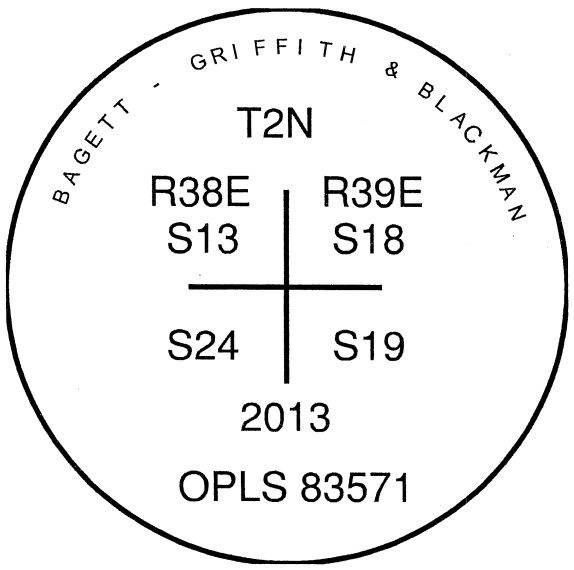

UNION COUNTY SURVEYOR
Date Received 6/3/13
Date Filed 6/3/13
Filed By
File Number 417-2013R

I used a steel tape and magnetic compass in the establishment of the accessories. I used 16° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing tree. Bearings and distances to the iron pin accessories are to the center of the aluminum cap.