CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established by Jacob C. Cooper under General Land Office contract no. 397, dated July 1, 1881. Surveyor General Records states:

Set post 3½ ft. long 3 ins. square 18ins. in ground with mound of stone alongside on summit of open ridge for ¼ section corner marked ¼ S on East and West faces;

A Pine 20 inches diameter bears N3°E, 112 lks. dist. marked ¼ S BT.

A Pine 20 inches diameter bears N24°W, 123 lks. dist. marked ¼ S BT.

Corner found in 1976 by survey number 43-76, surveyed by Duane I. Griffith. Plat states,"found SE BT to be recorded by GLO with a reversed bearing". Set 3/8"x10" spike at corner position. No record of subsequent remonumentation was found in County Records.

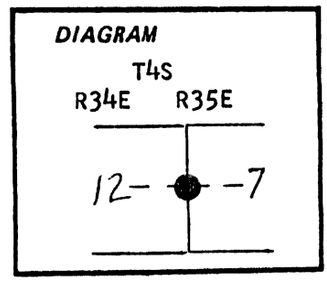

Description of corner evidence found:

Found 20" Ponderosa Pine snag with ¼S visible, S24°E, 81.2 feet.

Found 3/8"x10" spike set by survey number 43-76.

See map of survey dated November 1985.

Description of monument and accessories I established to perpetuate the original location of this corner: In place of spike, I set a 2½"x30" aluminum pipe with aluminum cap marked as shown, 15" in the ground with surrounding mound of stone From Which:

A 12" Ponderosa Pine bears N64°E, 158.39 feet, marked ¼ S 7 BT.

A 12" Ponderosa Pine bears N 78° W, 103.87 feet, marked ¼ S 12 BT.

I placed a steel fence post approx. 5 feet north with 54-4 sign attached.

Corner set 10/22/85
Witness: Greg Blackman, Rick Robinson

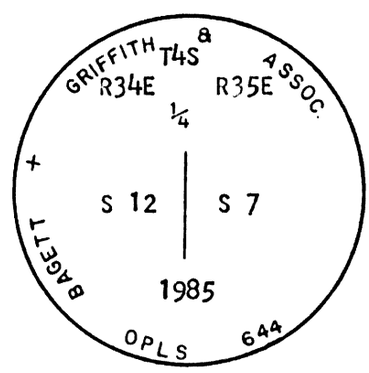

REGISTERED PROFESSIONAL LAND SURVEYOR
OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Brass washer nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Measured to 50d spike set in right side of tree when facing tree, unless otherwise stated.

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by .....
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR
Date Received 12-5-85
Date Filed 12-6-85
By G. LANGLITZ, DEPUTY
File No. 118-85 R

Form R6-7100-57 (9/71)

☆U.S. GOVERNMENT PRINTING OFFICE-1983-793-276

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was established by Jacob C. Cooper, US Deputy Surveyor, during the original survey Contract No. 397 dated July, 1881.

Set a post 3½ ft long 3 ins square 18 ins in ground with mound of stone alongside on summit of open ridge for ¼ sec cor marked 1/4S on East and West faces

A pine 20 ins. diam., bears N3°E, 112 lks. dist., marked 1/4 S BT

A pine 20 ins. diam., bears N24°W, 123 lks. dist., marked 1/4 S BT

DIAGRAM

T4S
R34E R35E

RESET 1989 | 1/4 S12|S 7 | PLS 699

1985
PLS 644

Corner was monumented by Duane I. Griffith, PLS 644, during a retracement survey dated November, 1985.

Corner found in 1976 by survey number 43-76, surveyed by Duane I. Griffith. Plat states, "found SE BT to be recorded by GLO with a reversed bearing. " Found 3/8"x10" spike set at corner postion by survey number 43-76. In place of spike, I set a 2½"x30" aluminum pipe with aluminum cap marked as shown, 15" in the ground with surrounding mound of stone. Brass washer nailed to BT blaze.

A 12" Ponderosa pine bears N64°E, 158.39 feet, marked 1/4 S7 BT

A 12" Ponderosa pine bears N78°W, 103.87 feet, marked 1/4 S12 BT

Measured to 50d spike set in right side of tree. I placed a steel fence post approx. 5 feet north with 54-4 sign attached. See map of survey dated November 1985.

Description of corner evidence found:

Found the monument has been dozed out of the ground. It appears to have occured when the line was cleared for the elk enclosure fence on the Starkey Experiment Station.

19" Ponderosa pine (16' Broken Stub)(Scribing Visible)(1881 BT) bears S28°15'E, 81.2 feet. Original bearing was reversed.

13" Ponderosa pine (Good Condition)(Scribing Visible)(1985 BT) bears S65°30'E, 158.2 feet. An apparent wrong quadrant shown on the corner record.

11" Ponderosa pine (Good Condition)(Scribing Visible)(1985 BT) bears N78°W, 103.8 feet.

20" pine (1881 BT) not found.

Description of monument and accessories I established to perpetuate the original location of this corner:

Reset the 2"x30" aluminum pipe with 2½" aluminum cap, marked as shown in the diagram, 16" in the ground to bedrock, using the bearing trees and distances from adjacent found corners to find the original monument hole. Rebuilt the mound with rock to be 36" in diameter by 8" high around the monument.

No new bearing trees set because others are not necessary.

AttentionBearings were turned from the control traverse with a theodolite, basis of bearing being the bearing between the SE and S¼ corners of Section 7 as shown on MOS 43-76, to stamped brass washers in the scribed blazes. Distances were measured from a 50d spike which was driven into the side of each BT approximately one foot above the ground.

Set a steel fence post 5 feet N of the corner with an Attention sign attached. The monument is not a National Forest property corner.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on July 18, 1989, I re-monumented the corner as herein described.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 9, 1965
LELAND LEE MYERS
699

FILED

IN THE OFFICE OF THE Union COUNTY SURVEYOR

THIS ____ DAY OF _____, 19____

Union County Surveyor

UNION COUNTY SURVEYOR
Date Received 9-25-89
Date Filed 9-25-89
By G. LANGLITZ
File No. 178-89R

USDA-FS Contract No. 04M3-8-6103

T4S R35E G-1