CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-02

History of original corner establishment:

ł

None.

DIAGRAM	
T1N R41E	
W1/16S6 T1S R41E	
κ.	

Description of corner evidence found:

None.

Description of monument and accessories | established to perpetuate the original location of this corner: Cap is marked: Corner set by proportioning. **T1N R41E** I set a 2¹/₂"x30" aluminum capped aluminum pipe rising 9" in a mound of stones. W1/16S6 Set steel fencepost 3 ft. South. **T1S R41E RLS1848** New BT's: 1986 A 9" Doug. Fir bears S795°E, 64.9 ft., blazed&scribed: W1/16S6BT An 8½" P. Pine bears S6%°W, 40.3 ft., blazed&scribed: W1/16S6BT Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982. A ½" brass disk stamped "RLS 1848" was nailed to the lower ends of the blazes. Corner is in opening on steep North slope 1/4 mile South & 1/4 mile West of UNION COUNTY intersection of 6200 & 6200600. SURVEYOR Compass Declination: 195°E REGISTERED Witness: Jeremy Sutton PROFESSIONAL Pate Received 12-5-86 LAND, SURVEYOR I hereby certify that the above described corner monument and/or Date Filed 12-5-80 accessories were established as hereon described on Oct. 15, 1986. By G. LANX-OREGON L-AIM JULY 13, 1979 B. A. SUTTON 1 8 4 8 File No. 300-86 R Office of...... County of..... for record on the...... day of..... by (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

AU.S. GOVERNMENT PRINTING OFFICE + 1983 -7 93 - 276

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

This corner was previously established incorrectly in Survey of Record File No. 300-86R, recorded December 5, 1986. Note: The monument described therein has been removed and placed as described below.

Index File No. A-02

DIAGRAM TIN R41E W1/16S6 TIS R41E

Description of corner evidence found:

From the corrected corner position,

Bearing trees found: 9 1/2" Douglas Fir bears S33 1/2°W, 16.9 ft., blazed & scribed: W1/16S6BT. 8 1/2" P. Pine bears S6 3/4°W, 40.3 ft. from found corner monument.

Description of monument and accessories | established to perpetuate the Cap is stamped: TIN R41E original location of this corner:

Corner set by proportioning. W1/1656 I set a 2.5"x30" aluminum capped aluminum pipe TIS R41E rising 9" in a mound of stones. Set steel fence post 3 ft. south of corner. RLS 1848 1987 Destroyed scribing on blaze of original P. Pine BT. Used original 9 1/2" Douglas Fir BT. Blaze still faces NW.


New BT:

A 12" Douglas Fir bears S50 1/4°E, 50.6 ft., blazed & scribed: W1/16S6BT.

Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982. A 3/4" brass washer stamped "RLS 1848" was nailed to the lower ends of the blazes.

Corner is in opening on steep North slope 1/4 mile south & 1/4 mile west of intersection of 6200 & 6200600.

Compass Declination: 19 1/2°E Witness: Jeremy Sutton

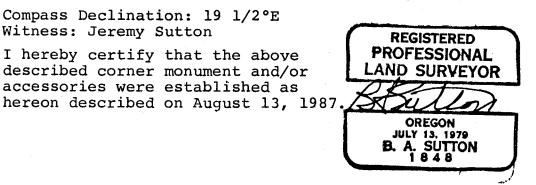

UNION COUNTY SURVEYOR	
Date Received 1-25-88	
Date Filed 1-26-88	
BY G. LANGLITZ DEPUTY	
File No. 53-88R	

Office of	County of
	reby certify that the within instrument was filed in this office
for record on the day of	
•••••••••••••••	by
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

\$ GPO-798-276