

442

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 2 S., R. 34 E., Willamette Meridian, Oregon

CHAINS

from which the remains of the original bearing trees

A root hole, bears S. 70° E., 9 lks. dist., with a down fir, 10 ins. diam., lying alongside, no marks visible.

A root hole, bears S. $64\frac{1}{2}^{\circ}$ W., 34 lks. dist., with a rotted fir, 13 ins. diam., lying alongside, no marks visible. (Record, S. 60° W.)

and the remains of a bearing tree mkd. by Wilkes

A rotted pine stump, 17 ins. diam., bears N. 30° E., 101 lks. dist., with scribe marks CC S35 on partially healed blaze. (Record, N. 24° E.)

and the remains of bearing trees mkd. by Barbour

A larch, 13 ins. diam., bears N. $86\frac{1}{2}^{\circ}$ E., $80\frac{1}{2}$ lks. dist., with scribe marks T2S R34E S36 CC BT on partially healed blaze.

A larch snag, 12 ins. diam., bears N. $66\frac{1}{2}^{\circ}$ W., 49 lks. dist., with scribe marks T2S R34E S35 CC BT on partially healed blaze.

The corner is located on level ground.

From this point, the $62\frac{1}{2}$ Mile Corner on the E. bdy. of the Umatilla Indian Reservation, perpetuated and recorded by Barry B. Barbour, Registered Land Surveyor No. 1051, in 1980, bears N. $21^{\circ} 13' 00''$ E., 1.200 chs. dist., monumented with an iron post, 2 ins. diam., firmly set, protruding 8 ins. above ground, with brass cap mkd.

\swarrow
62½ M
1917

MP62.5

from which the remains of the original bearing trees

A rotted and broken pine stump, 16 ins. diam., bears S. 17° E., $24\frac{1}{2}$ lks. dist., with illegible scribe marks on rotted blaze.

A rotted and broken larch stump, size indeterminate, bears N. 28° W., 34 lks. dist., with down larch lying alongside, with scribe marks $62\frac{1}{2}$ UR BT on rotted blaze. (Record, fir, N. 31° W.)

UNION COUNTY
SURVEYOR

Date Received 3/8/13

Date Filed 3/8/13

By J. L. DEWITT

File No. Z15-2013R

443

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 2 S., R. 34 E., Willamette Meridian, Oregon

CHAINS

and bearing trees mkd. by Barbour

A ponderosa pine, 17 ins. diam., bears S. 58 $\frac{3}{4}$ ° E.,
24 lks. dist., with illegible scribe marks on
partially healed blaze.

A fir, 17 ins. diam., bears N. 81 $\frac{1}{2}$ ° W., 54 $\frac{1}{2}$ lks. dist.,
with illegible scribe marks on partially healed blaze.

From this same point, the SE. cor. of the Umatilla Indian
Reservation, perpetuated and recorded by Barry B. Barbour,
Registered Land Surveyor No. 1051, in 1980, bears
S. 20° 30' 30" W., 6.865 chs. dist., monumented with an iron
post, 2 ins. diam., firmly set, protruding 12 ins. above ground,
with brass cap mkd.

T 2 S R 34 E
SE COR
UIR
1917

from which the remains of the bearing trees mkd. by Wilkes

A fir stump, 18 ins. diam., bears N. 10 $\frac{1}{2}$ ° E., 43 lks.
dist., with illegible scribe marks on rotted blaze.
(Record, N. 13 $\frac{1}{2}$ ° E.)

A root hole, bears S. 40 $\frac{3}{4}$ ° E., 26 lks. dist., with
rotted pine, size indeterminate, lying alongside,
with scribe marks UR BT on partially healed blaze.

and bearing trees mkd. by Barbour

A larch, 16 ins. diam., bears S. 13° E., 70 $\frac{1}{2}$ lks. dist.,
with scribe marks UIR SE COR BT and a nail and washer
at base of partially healed blaze.

A larch, 14 ins. diam., bears N. 16° W., 28 $\frac{1}{2}$ lks. dist.,
with scribe marks UIR SE COR BT and a nail and washer
at base of partially healed blaze.

From the $\frac{1}{4}$ sec. cor. of secs. 35 and 36.

N. 0° 18' 30" E., bet. secs. 35 and 36.

Over level ground, through timber and light undergrowth.

38.00

Abandoned dirt road, 15 lks. wide, bears N. 80° W. and S. 60° E.

UNION COUNTY SURVEYOR	
Date Received	3/8/13
Date Filed	3/8/13
By	<i>[Signature]</i> DEPUTY
File No.	215-2013R

Retracement-Resurvey of the East Boundary
Original Umatilla Indian Reservation

Chains

of secs. 25 and 36, the position of which is determined from original bearing tree, as follows:

A fir, 10 ins. diam., bears S.70°E., 9 lks. dist., marked U I R B T.

The $\frac{1}{4}$ cor. bet. secs. 35 and 36 bears N.2°10'E., 0.92 chs. dist.

8.05 The 62 $\frac{1}{2}$ Mile Cor., which is a decayed post. In its place Set an iron post, 3 ft. long, 2 ins. diam., 24 ins. in the ground, for 62 $\frac{1}{2}$ Mile Cor., with brass cap marked

T2S R34E
UIR / 62 $\frac{1}{2}$ M
1917

from which

A pine, 22 ins. diam., bears S.17°E., 24 $\frac{1}{2}$ lks. dist., blazes healed over and unopened.

A fir, 20 ins. diam., bears N.31°W., 34 lks. dist., blazes healed over and unopened.

I remark these trees U R 62 $\frac{1}{2}$ M B T.

thence

N.20°30'E., continuing my measurements.

15.65 "Daly" wagon road, bears NW. and SE.

23.05 Leave rolling land and descend 400 ft., closely following summit of low ridge.

47.86 The 62 Mile Cor., heretofore described.

Land, mountainous and bench.

Soil, light loam, shallow, on basalt bedrock; 2nd rate.

Timber, pine, fir and balsam.

Undergrowth, fir, balsam and willow.

UNION COUNTY SURVEYOR	
Date Received	<u>3/11/13</u>
Date Filed	<u>3/11/13</u>
By	<u>[Signature] DEPUTY</u>
File No.	<u>262-2013R</u>

Retracement-Resurvey of the South Boundary
Original Umatilla Indian Reservation

From the SE. angle cor. of the Umatilla Indian Reservation West, retracing the 63rd Mile.

32.30 Fall 17 lks. N. of the 63 Mile Cor., the position of which being determined from the original bearing trees.


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. M.P. 62 1/2

History of original corner establishment:

Corner was recovered by L. Wilkes, survey group No. 38, during October, 1917. Surveyors General's notes state: "Set an iron post, 3 ft. long, 2 ins. diam., 24 ins. in the ground, for 62 1/2 Mile Cor., with brass cap marked:

T2S R34E
ULR / 62 1/2 M
1917

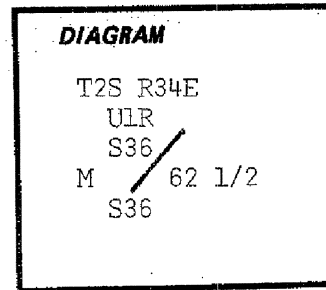

from which: A pine, 22 ins. diam., bears S17°E., 24 1/2 lks. dist. blazes healed over and unopened. A fir, 20 ins. diam., bears N31°W, 34 lks. dist., blazes healed over and unopened."

Description of corner evidence found:

Found 2" iron pipe and brass cap projecting 10" above the ground. From which: A rotten stump bears S20°E, 16.7 ft. A 21" fir snag bears N32°W, 23.0 ft. scribed 62 1/2 UR BT.

Marked:
T2S R34E
ULR /
M 62 1/2
1917

Description of monument and accessories established to perpetuate the original location of this corner:

From which I add: A 16" pine bears S61°E, 15.8 ft. scribed ULR MP 62 1/2 BT. A 16" fir bears N84°W, 36.2 ft. scribed ULR MP 62 1/2 BT. Painted blazes red and 6" red band around. Placed 54-3s, 54-4s and brass washers stamped PLS 1051 on BTs. Placed 54-4 on steel fence post S20°W, 5 feet.

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Daniel Rowland
Douglas Moser
Ronald Gilroy

November 11, 1980

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Barry B. Barbour
OREGON
OCT. 17, 1975
BARRY B. BARBOUR
1031

UNION COUNTY SURVEYOR
Date Received _____
Date Filed _____
By NARRATIVE DRAWER 1/3
File No. _____

REFER TO SURVEY 10-81

Office of... County Surveyor... County of Union...
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 30th day of January, 1981.

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

UNION COUNTY SURVEYOR
★ GPO-798-275
Date Received 8/12/13
Date Filed 3/12/13
By [Signature] DEPUTY
File No. 285-2013R