

Retracement-Resurvey of the East Boundary  
Original Umatilla Indian Reservation

Chains

Descend 90 ft. to

46.10 Dry gulch, course NW.; ascend 40 ft. to

50.66 Pass 40 lks. N.70°W. of old cabin on top of ridge, descending  
NW.

54.64 Dry gulch, course W.; ascend 200 ft. to

60.78 Top of ascent; enter bench land, bears NW. and SE.

80.05 The 61 Mile Cor., heretofore described.

Land, mountainous.

Soil, light loam, gravelly, shallow, over basalt bedrock;  
2nd rate.

Timber, pine, fir and tamarack.

Undergrowth, pine, fir, tamarack and willow.

From the 62 Mile Cor.

S.20°00'W., retracing the 63rd Mile

39.81 Pass 10 lks. S.70°E. of the 62½ Mile Cor., hereinafter  
described.

Fall 16 lks. S.70°E. on Angle Cor. of Umatilla Indian

Reservation, which is a post, now rotted off, marked as  
described by the surveyor general, the markings being  
nearly illegible. At exact cor. point

Set an iron post, 3 ft. long, 2 ins. diam., 24 ins. in the  
ground, for angle cor., with brass cap marked

T2S R34E  
UIR/  
1917

From which

A fir, 18 ins. diam., bears N.13°30'E., 43 lks. dist.,  
marked > U R B T (new B.T.)

A lodgepole pine, 5 ins. diam., bears S.40°45'E., 26  
lks. dist., marked > U R B T (new B.T.)

A fir, 8 ins. diam., bears S.25°W., 13½ lks. dist.,  
marked U R B T (old B.T.)

Thence

N.20°25'E., on a true line, resurveying the 63rd Mile.

6.85 Intersect line bet. secs. 35 and 36, at the closing cor.

<b>UNION COUNTY 86 SURVEYOR</b>	
Date Received	3/11/13
Date Filed	3/11/13
By	J. L. DEPUTY
File No.	2772013R

7-6

Retracement-Resurvey of the East Boundary

Original Umatilla Indian Reservation

Chains

of secs. 25 and 36, the position of which is determined from original bearing tree, as follows:

A fir, 10 ins. diam., bears S.70°E., 9 lks. dist., marked U I R B T.

The  $\frac{1}{2}$  cor. bet. secs. 35 and 36 bears N.2°10'E., 3.92 chs. dist.

8.05 The 62 $\frac{1}{2}$  Mile Cor., which is a decayed post. In its place set an iron post, 3 ft. long, 2 ins. diam., 24 ins. in the ground, for 62 $\frac{1}{2}$  Mile Cor., with brass cap marked

T2S R34E

UIR / 62 $\frac{1}{2}$ M

1917

from which

A pine, 22 ins. diam., bears S.17°E., 24 $\frac{1}{2}$  lks. dist., blazes healed over and unopened.

A fir, 20 ins. diam., bears N.31°W., 34 lks. dist., blazes healed over and unopened.

I remark these trees U R 62 $\frac{1}{2}$  M B T.

Thence

N.20°08'E., continuing my measurements.

15.65 "Daly" wagon road, bears NW. and SE.

23.05 Leave rolling land and descend 400 ft., closely following summit of low ridge.

47.86 The 62 Mile Cor., heretofore described.

Land, mountainous and bench.

Soil, light loam, shallow, on basalt bedrock; 2nd rate.

Timber, pine, fir and balsam.

Undergrowth, fir, balsam and willow.

UNION COUNTY SURVEYOR

Date Received 3/4/13

Date Filed 3/4/13

By M J L DEARY

File No. 277-2013R

Retracement-Resurvey of the South Boundary  
Original Umatilla Indian Reservation

From the SE. angle cor. of the Umatilla Indian Reservation West, retracing the 63rd Mile.

32.30 Fall 17 lks. N. of the 63 Mile Cor., the position of which being determined from the original bearing trees.

441

Dependent Resurvey of a Portion of the Subdivisional Lines,  
T. 2 S., R. 34 E., Willamette Meridian, Oregon

CHAINS

(Restoring the survey by James P. Currin and James E. Noland,  
in 1887, and the resurvey by Lincoln L. Wilkes, in 1917)

From the  $\frac{1}{4}$  sec. cor. of secs. 35 and 36, perpetuated and recorded  
by Barry B. Barbour, Registered Land Surveyor No. 1051, in 1980,  
monumented with an iron post, 2 ins. diam. firmly set,  
protruding 6 ins. above ground, in a collar of stone, with brass  
cap mkd.

T 2 S R 34 E

$\frac{1}{4}$

S 35 | S 36  
OR PLS 1051  
1980

from which an original bearing tree

A larch, 17 ins. diam., bears S.  $79\frac{1}{2}^{\circ}$  E., 55 lks. dist.,  
with scribe marks  $\frac{1}{4}$  S36 BT on chopped open blaze.  
(Record, fir, S.  $70^{\circ}$  E., 25 lks.)

and a bearing tree mkd. by Wilkes

A fir, 16 ins. diam., bears N.  $80^{\circ}$  E., 2 lks. dist.,  
no marks visible on partially healed, rotted blaze.

and the remains of a bearing tree of no known record


A fir snag, 22 ins. diam., bears S.  $38^{\circ}$  W., 35 lks. dist.,  
with illegible scribe marks on bark.

S.  $2^{\circ} 27' 00''$  W., bet. secs. 35 and 36.

Over level ground, through timber and light undergrowth.

3.915

Intersect the E. bdy. of the Umatilla Indian Reservation at the  
original closing cor. of secs. 35 and 36, designated as the  
closing cor. for both sides of the Reservation boundary by Wilkes  
in 1917, perpetuated and recorded by Barry B. Barbour, Registered  
Land Surveyor No. 1051, in 1980, monumented with an iron post, 2  
ins. diam., firmly set, protruding 8 ins. above ground, with  
brass cap mkd.

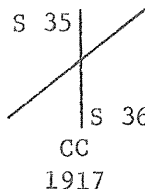

UNION COUNTY  
SURVEYOR

Date Received 3/8/13

Date Filed 3/8/13

By J. B. & L. DEAT

File No. 253-2013R

Dependent Resurvey of a Portion of the Subdivisional Lines,  
T. 2 S., R. 34 E., Willamette Meridian, Oregon

CHAIN

from which the remains of the original bearing trees

A root hole, bears S.  $70^{\circ}$  E., 9 lks. dist., with a down fir, 10 ins. diam., lying alongside, no marks visible.

A root hole, bears S.  $64\frac{1}{2}^{\circ}$  W., 34 lks. dist., with a rotted fir, 13 ins. diam., lying alongside, no marks visible. (Record, S.  $60^{\circ}$  W.)

and the remains of a bearing tree mkd. by Wilkes

A rotted pine stump, 17 ins. diam., bears N.  $30^{\circ}$  E., 101 lks. dist., with scribe marks CC S35 on partially healed blaze. (Record, N.  $24^{\circ}$  E.)

and the remains of bearing trees mkd. by Barbour

A larch, 13 ins. diam., bears N.  $86\frac{1}{4}^{\circ}$  E.,  $80\frac{1}{2}$  lks. dist., with scribe marks T2S R34E S36 CC BT on partially healed blaze.

A larch snag, 12 ins. diam., bears N.  $66\frac{1}{2}^{\circ}$  W., 49 lks. dist., with scribe marks T2S R34E S35 CC BT on partially healed blaze.

The corner is located on level ground.

From this point, the  $62\frac{1}{2}$  Mile Corner on the E. bdy. of the Umatilla Indian Reservation, perpetuated and recorded by Barry B. Barbour, Registered Land Surveyor No. 1051, in 1980, bears N.  $21^{\circ} 15' 00''$  E., 1.200 chs. dist., monumented with an iron post, 2 ins. diam., firmly set, protruding 8 ins. above ground, with brass cap mkd.

$62\frac{1}{2}$  M  
1917

from which the remains of the original bearing trees

A rotted and broken pine stump, 16 ins. diam., bears S.  $17^{\circ}$  E.,  $24\frac{1}{2}$  lks. dist., with illegible scribe marks on rotted blaze.

A rotted and broken larch stump, size indeterminate, bears N.  $28^{\circ}$  W., 34 lks. dist., with down larch lying alongside, with scribe marks  $62\frac{1}{2}$  UR BT on rotted blaze. (Record, fir, N.  $31^{\circ}$  W.)

UNION COUNTY  
SURVEYOR

Date Received 3/8/13

Date Filed 3/8/13

By J. L. DEATY

File No. 253-2013R


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

Index File No. X-Y-21

**History of original corner establishment:**

Corner was originally established by Currin and Noland, under G.L.O. contract on July 16, 1887. Corner was recovered in October, 1917 by L. Wilkes, surveying under group #38. Surveyors General's notes state: "Set an iron post, 3 ft. long 2 ins. diam., 24 ins. in the ground, for closing cor. of secs. 35, and 36, with brass cap marked:

T2S R34E  
S35  
S36  
CC  
1917

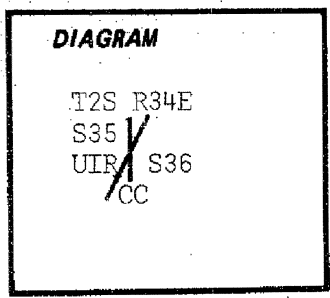

Form which A pine, 22 ins. diam. bears N24°E., 101 lks. dist. marked CCS36 BT.  
A fir, 6 ins. diam. bears S47°30'W., 23 lks. dist. marked CCS35 BT."

**Description of corner evidence found:**

Found 2" iron pipe and brass cap projecting 12" above the ground. From which: By magnetic declination of N20°E;  
A 14" tamarac bears S47°W, 15.5 ft. visible scribing, partially opened blaze.

Marked:  
T2S R34E  
S35  
UIR S36  
CC  
1917

**Description of monument and accessories I established to perpetuate the original location of this corner:**

From which I add;  
A 16" tamarac bears N85°E, 53.3 ft. scribed T2SR34ES36CC BT. A 14" tamarac bears N72°W, 32.3 ft. scribed T2SR34ES35CC BT. Painted blazes red and 6" red band around. Placed 54-3s, 54-4s and brass washers stamped PLS 1051 on BTs. Placed 54-2 on steel fence post S20°W, 5 ft. and 54-2 and 54-4 on a steel fence post 5' south of the corner.

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Daniel Rowland  
Douglas Moser  
Ronald Gilroy

November 11, 1980

**REGISTERED PROFESSIONAL LAND SURVEYOR**  
*Barry B. Barbour*  
**OREGON**  
OCT. 17, 1975  
**BARRY B. BARBOUR**  
1051

**UNION COUNTY SURVEYOR**  
Date Received \_\_\_\_\_  
Date Filed \_\_\_\_\_  
By \_\_\_\_\_  
NARRATIVE DRAWER 1/3  
File No. \_\_\_\_\_

REFER TO SURVEY 10-81

Office of \_\_\_\_\_ County Surveyor \_\_\_\_\_ County of \_\_\_\_\_ Union \_\_\_\_\_  
State of \_\_\_\_\_ Oregon \_\_\_\_\_, I hereby certify that the within instrument was filed in this office  
for record on the \_\_\_\_\_ 30th day of \_\_\_\_\_ January \_\_\_\_\_, 19 \_\_\_\_\_ 81  
\_\_\_\_\_ by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY SURVEYOR**  
Date Received <sup>798276</sup> 3/12/13  
Date Filed 3/12/13  
By *[Signature]* DEPUTY  
File No. 287-2013R