


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Z-25

History of original corner establishment:

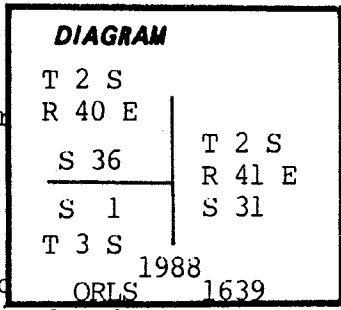

Corner ESTABLISHED by W.B.Barr under GLO Contract No.355 dated June 14,1880, and his record states: Set stake 5 ft long 5 in diam 30 ins in ground for corner to Secs 1,6,31 & 36 also corner of Township 2 & 3 South Range 40 & 41 East from which: Pine 4 in diam bears N42°E,18 lks dist. Pine 4 in diam bears N16°W, 53 lks dist. Pine 3 in diam bears S47°W,80 lks dist. Tamarack 6 in diam bears S58°E, 87 lks dist.

Corner OBSERVED by Henry Meldrum under GLO Contract No.450 dated June 11,1882, and his record states: Begin at Corner to Township 2 & 3 South RS40 & 41 E which is a post 5 ft long 5 in square marked T2S.S31 on NE, R41ES6 on SE, T3S.S1 on SW and R40ES36 on NW faces with 6 notches on each edge from which: A pine 4 in dia brs N42°E,18 lks dist mkd T2SR41ES31 BT. A pine 4 in dia brs N16°W,53 lks dist mkd T2SR40ES36 BT. A pine 3 in dia brs S47°W,80 lks dist mkd T3SR40ES1 BT. A tamarack 6 in diam brs S58°E,87 lks dist mkd T3SR41ES6 BT.

Corner MODIFIED to refer to two townships only by Alonzo Gesner under GLO Contract No.683 dated June 07,1898, and his record states: Intersected west Bndy of Tp. 17.84 chs. south of Tps. 2 & 3 S which is a post 5 ins sq & 3 ft above ground mkd and witnesses as stated by the U.S.Surveyor General. I obliterated marks on the NE & SE faces of the post also obliterated marks on the bearing trees relating to Tps 2 & 3 SR41E.

The original corner post or accessories were not recovered in old burned area.

Note: A standing dead lodgepole pine 12 ins in diam. with a healed single blaze breast high on each of four sides (3" overgrowth) brs N10°E, 9.7 ft dist from reestablished township corner position...significance and origin unknown.

Description of monument and accessories I established to perpetuate the original location of this corner:

This corner position is reestablished by the method of two-point control using the record of the most recent retracement performed by Alonzo Gesner in 1898 between the recovered east quarter Section corner of Sec 36 T2SR40E to the North and the recovered corner to townships 2 & 3 South, Range 41 E only to the South. At the proportioned position established by survey...

Set 2½" aluminum cap on 2" aluminum pipe 24" in ground & 6" projecting out of ground with surrounding earth mound & 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A spruce 11" diam brs N03°W, 7.6 ft dist mkd T2SR40ES36 BT.
A spruce 10" diam brs S84°W, 15.0 ft dist mkd T3SR40ES1 BT.

New bearing trees have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly reestablished by me and witnessed by Jim DeMastus on August 19, 1988.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of..... County Surveyor..... County of..... Union.....
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR	
6-8-89	
Date R.G.P.O. 591-971, 1988	
Date Filed 6-9-89	
By <u>G. LANGRISH, DEPUTY</u>	
File No. 122-89 R	

A-25