
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. N-03

History of original corner establishment:

Original corner established in 1898 by Alonzo Gesner under contract #683. He set a White Fir Post 4'x3"x3", 24" in ground. From which:

A 40" White Fir bears N61°E, 21 lks. A 14" White Fir bears S3°W, 9 lks.

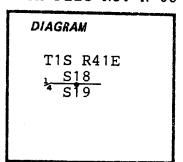

Description of corner evidence found:

No corner monument found.

A 40" White Fir Stump bears N61°E, 21 lks, no marks. A 36" White Fir Stump bears East, 39 lks, no marks.(Line tree) The two fir stumps found fit well for terrain call to the creek 1.7 chains east. They also fit for alignment and distance to the line tree found 13.8 chains East.

Description of monument and accessories I established to perpetuate the original location of this corner:

Cap is stamped: From original evidence, I set 2½"x30" aluminum capped aluminum pipe rising 6" above ground No stones available.
Set a steel fence post 3 ft. north of corner.

T1S R41E 1 S18 4 S19 RLS1848 1986

New BT's:

A 12½" Western Larch bears N30°W, 238.2 ft., blazed&scribed: \$518BT A 14" Doug Fir bears S42½°W, 44.4 ft., blazed&scribed: \$519BT

Painted blazes and attached signs as required in Specifications for Cadastral Surveys, USFS Region 6, March, 1982. A  $\frac{3}{4}$ " brass disk stamped "RLS1848" is nailed to lower end of blazes.

To find corner follow Rd. 6200485 South 600 feet, corner is west across creek 250 feet in opening.

Compass Declination: 19½°E Witness: Jeremy Sutton

I hereby certify that the above described corner monument and/or accessories was perpetuated as hereon described on Oct. 2, 1986. REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 13, 1979
B. A. SUTTON
1 8 4 8

UNION	COUN	ΓY
SURV	/EYOR	

Date Received 12-1-86

n. el 110. 7. 04

BYG, LANGLITZ, DE

.. File No. 288 - BG R

Form R6-7100-57 (9/71)