


History of original corner establishment:

Corner originally established by Jacob C. Cooper under GLO contract number 397 dated July 1, 1881. Surveyor General record states:

Set post 4 ft long 4 ins square for cor to secs 4-5-32 and 33 from which;

- A pine 14 ins dia bears N87°E 18 lks dist
- A tamarack 9 ins dia bears S55°W 82 lks dist
- A pine 12 ins dia bears S89°E 22 lks dist

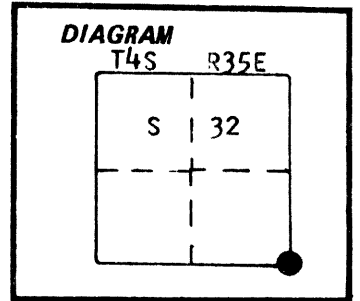

No record of subsequent remonumentation found

Description of corner evidence found:

- Found a 27 inch diameter P.Pine N87°E 11.9 feet live and vigorous with scribes visible
- Found a 32 inch diameter P.Pine S89°E 14.5 feet live and vigorous with scribes visible
- Found a 16 inch diameter Tamarack S55°W 54.1 feet live and vigorous with blaze evident (did not open)

**UNION COUNTY SURVEYOR**

---

Date Received 5-5-86

Date Filed 5-5-86

By G. LANGLITZ DEPUTY

File No. 30-86 R

Description of monument and accessories I established to perpetuate the original location of this corner: At record bearing and distance from the found BTs, I set a 2 1/2"x30" aluminum pipe with aluminum cap marked as shown, 30 inches in the ground, with mound of stone from which:


New BT

A 18 inch diameter Red Fir bears N44°W 53.47 feet marked T4S R35E S32BT

Set a steel fencepost approximately 5 feet North with 54-4 sign

Distance to original BTs are to the face of the blaze

Corner rehabilitated April 29, 1986

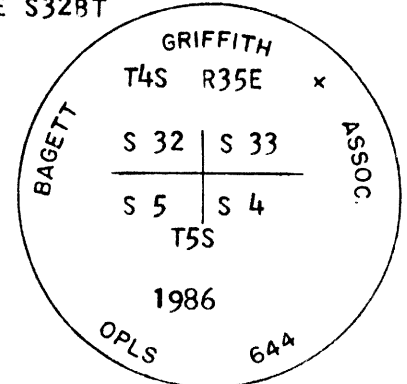

I used a steel tape and magnetic compass in the establishment of these accessories. I used 20° East magnetic declination and the distances are to a 50d spike driven at the root crown on the right side of the BT. I attached a brass washer marked OPLS 644 by the BT blaze of the new BTs.

Office of..... County of.....  
 State of....., I hereby certify that the within instrument was filed in this office  
 for record on the..... day of....., 19.....  
 ..... by .....  
 (COUNTY OFFICIAL) (DEPUTY)