

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Joseph Gray and William Odell in GLO Contract No. 120, dated May 27, 1867. Surveyor General field notes state:

T 1 N R 38 E T-21

Set 1/4 Section cor. post, from which:

- A Pine 10 in. diam. bears S17°E, 22 lks.
- A Pine 24 in. diam. bears N85°W, 50 lks.

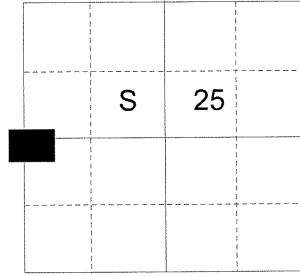

In Survey Number 022-1997, Duane Griffith finds no remaining evidence of the corner.

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

See Survey Number 029-2013

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the proportionate position, I set a 2 1/2" x 30" aluminum pipe, 28 inches in the ground, with a 2 1/2" aluminum cap marked as shown below, from which:

- A 13 inch Ponderosa Pine bears North 13° East, a distance of 70.30 feet, marked 1/4 S25 BT.
- A 10 inch Ponderosa Pine bears South 18° East, a distance of 40.50 feet, marked 1/4 S25 BT.
- A 24 inch Ponderosa Pine bears South 29° West, a distance of 45.45 feet, marked 1/4 S26 BT.
- A 22 inch Ponderosa Pine bears North 71° West, a distance of 23.20 feet, marked 1/4 S26 BT.

Corner falls approximately 15 feet South of a fence corner. Fencelines run North and East/West.

I hereby certify that the corner was monumented on July 2, 2013.


Witness: Daniel Inloes

REGISTERED
PROFESSIONAL
LAND SURVEYOR



OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2015

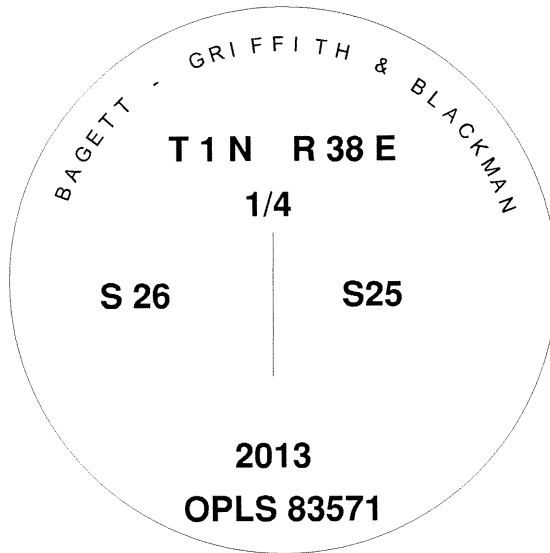

**UNION COUNTY
SURVEYOR**

Date Received 7/3/13

Date Filed 7/3/13

Filed By N. L. G. Mhu

File Number 421-2013R

I use a steel tape and magnetic compass in the establishment of the accessories. Bearings are to a brass washer marked OPLS 83571 in the upper portion of the lower blaze. Distances are to a 60d spike located in the right hand side of the tree. Magnetic declination used was 16° East.