

TOWNSHIP 1 N, RANGE 38 E.

CORNER DIAGRAM

CENTER  $\frac{1}{4}$  CORNER  
SECTION 32

UNION COUNTY SURVEYOR	
Date Received	<u>12-29-83</u>
Date Filed	<u>12-29-83</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>423-83 R</u>

REFER TO FILE NO. \_\_\_\_\_

REFERENCES TO PRIOR RECORDS  
SURVEY 38-80, 43-83

THIS SPACE RESERVED FOR  
USE BY COUNTY SURVEYOR

MONUMENT(S) FOUND: (CONDITION AND SOURCE)

MONUMENT DETAIL

FOUND  $\frac{5}{8}$ " IRON ROD WITH PLASTIC CAP MARKED  
"AP & A" AS SET BY SURVEY 38-80.  
MONUMENT IS IN GOOD CONDITION.

ACCESSORIES FOUND: (CONDITION AND SOURCE)

NONE

MONUMENT SET (PROCEDURE AND DESCRIPTION)

MONUMENT DETAIL

NONE  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

NEW ACCESSORIES

NONE  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_


SKETCH OF MONUMENT, ACCESSORIES AND GENERAL AREA  
(IF NEEDED FOR CLARIFICATION)

LOCATION & COMMENTS

CORNER IS LOCATED ON STEEP  
EAST SLOPE, APPROX. 100 FT.  
EAST OF N-S ROAD AND  
APPROX. 200 FT. WEST OF  
N-S ROAD.

DATE DEC. 29, 1983  
COMPASS DECLIN. \_\_\_\_\_  
FIRM/AGENCY ANDERSON-PERRY & ASSOC.  
PARTY CHIEF GARY LANGLITZ  
WITNESSES RAY CRAPO

SURVEYOR'S SEAL

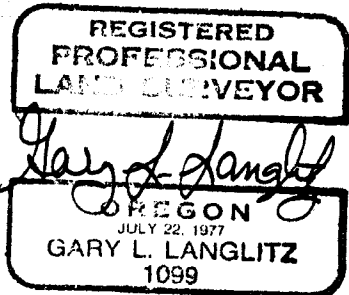

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**History of original corner establishment:**

Corner established in 1980 by Union County Survey No. 38-80. Refer also to Union County Surveyor's Corner Remonumentation Record No. 423-83R

**Diagram**

T 1N, R 38 E  
Center 1/4 Corner  
Section 32

**Description of corner evidence found:**

Found 5/8" iron rod as set by Union County Survey No. 38-80, with yellow plastic cap attached, marked "AP&A".


**Description of monument and accessories I established to perpetuate the original location of this corner:**

With reference to Union County Survey No. 035-1995, set a 5/8" iron rod (concrete reinforcing rod) at the corrected corner location, with yellow plastic cap attached, marked "AP&A", from which:

- a 5/8" iron rod with yellow plastic cap attached, marked "AP&A", set by Survey 38-80, bears North 3.60 feet, removed the plastic cap and buried the iron rod 0.5 feet,
- set a bearing object, a 5/8"X30" iron rod (concrete reinforcing rod) with yellow plastic cap attached, marked "AP&A", bears S 77 1/2 degrees W 9.5 feet,
- a new bearing tree, an 8" diameter White Fir, scribed "C1/4 S32 BT" on a double blaze and brass washer marked "LS 1099" attached to the lower blaze bears N 44 degrees E 39.4 feet,
- a new bearing tree, a 12" diameter P. Pine, scribed "C1/4 S32 BT" on a double blaze and brass washer marked "LS 1099" attached to the lower blaze bears S 33 degrees E 60.8 feet

Bearings by magnetic compass, declination 17 1/2 degrees East.  
Distances by steel tape.

Corner visited on: August 21, 1995  
Record prepared on: September 13, 1995  
Survey field crew: Gary Langlitz, PLS  
Jim Arnott

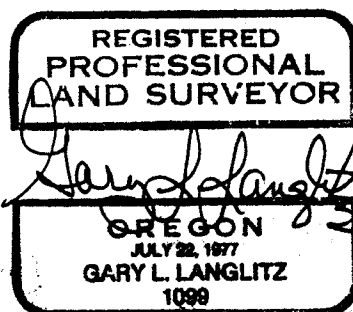

EXPIRES: 12-31-96

9-21-95

Anderson-Perry & Associates, Inc.  
P.O. Box 1107  
La Grande, Oregon 97850

<b>UNION COUNTY SURVEYOR</b>	
Date Received	9-21-95
Date Filed	9-22-95
By	R. ROBINSON, DEPUTY
File No	025-1995R