


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. C-01

History of original corner establishment:

None.

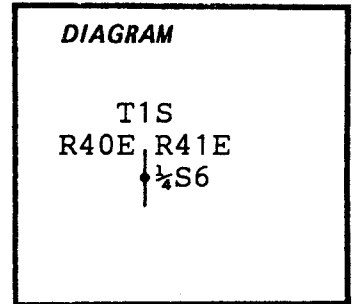

Description of corner evidence found:

None.

Description of monument and accessories established to perpetuate the original location of this corner:

Cap is marked:

Corner set by proportioning. I set a 2 1/2"x30" aluminum capped aluminum pipe rising 8" no stones available. Set steel fencepost 3 ft. North.

T1S
R40E, R41E
1/4S6
RLS1848
1986

New BT's:

- A 7 1/2" Doug Fir bears N64 1/2°E, 36.5 ft., blazed&scribed: 1/4S6BT
- A 5" White Fir bears S38 1/4°E, 30.4 ft., blazed&scribed: 1/4S6BT

Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982. A 1/4" brass disk stamped "RLS 1848" was nailed to the lower ends of the blazes.

From the end of 6200600, follow fence line North 1800 ft. to corner on NW'ly slope.

Compass Declination: 19 1/2°E
Witness: Jeremy Sutton

I hereby certify that the above described corner evidence was found and evaluated as hereon described on Oct. 10, 1986.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 13, 1979
B. A. SUTTON
1848

UNION COUNTY SURVEYOR

Date Received 12-5-86

Date Filed 12-5-86

By G. LANGLITZ, DEPUTY

File No. 296-86R

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)