
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Rufus S. Moore under GLO contract number 382 dated March 23, 1881. Surveyor General field notes state:


Set post for 1/4 sec. cor. from which:

A Fir 15 ins. diam bears N 40° W 17 lks dist A Fir 10 ins diam bears S 46° W 10 lks dist



No original evidence found.

A 36" White Fir bears North West approx. 50', with multiple openings on trunk and Westerly and Southerly blaze lines meeting on it, (no scribes). Not accepted as original evidence.

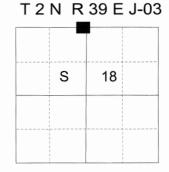

See Survey Number 032-2019

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position I set a 2 $\frac{1}{2}$ " x 30" aluminum pipe 28" in the ground with 3 $\frac{1}{2}$ " aluminum cap marked as shown below, from which:

NEW BEARING OBJECTS:

A 23" White Fir bears South 74° East a dist. of 10.55 ft., marked 1/4 S18 BT. A 6" White Fir bears South 12° East a dist. of 20.45 ft., marked 1/4 S18 BT. A 32" White Fir bears South 27° West a dist. of 2.55 ft., marked 1/4 S18 BT. An 18" White Fir bears North 21° East a dist. of 1.95 ft., marked 1/4 S7 BT on Southerly facing blaze.

I hereby certify that the corner was monumented on October 2, 2019. Witness: Kyle A. Tucker

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON June 2, 2010 JEFFREY S. HSU 83571

Renewal Date: June 30, 2021

T2N R39E OF ST 1/4 S18
2019
OPLS 83571

Date Filed 10 23/19

UNION COUNTY

File Number 070 - 10191

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.