
UNION COUNTY CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was originally set by Rufus S. Moore under GLO contract no. 382, dated March 23, 1881. Surveyor General record states:

Set basalt stone 15x12x8 for section corner

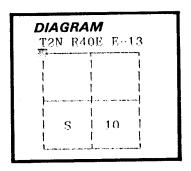

No record of subsequent monumentation found in Union County survey records

Description of corner evidence found:

Found stone 15" x 12" x 8" with faint chisel marks in fence corner, fences running N-E-W.

See Map of Survey Number 015-1992.

Description of monument and accessories I established to perpetuate the original location of this corner:


In place of found original corner stone, I set a 2 1/2" x 30" aluminum pipe with aluminum cap marked as shown. 24 inches in the ground with mound of stone, from which:

A 5/8" x 30" rebar bears N1°E, 5.27 feet with 2" aluminum cap marked "UNION COUNTY SURVEYOR NE RP".
A 5/8" x 30" rebar bears S89°E, 6.28 feet with 2" aluminum cap marked "UNION COUNTY SURVEYOR SE RP".
A 5/8" x 30" rebar bears S89°W, 7.10 feet with 2" aluminum cap marked "UNION COUNTY SURVEYOR SE RP".

A 5/8" x 30" rebar bears \$89°W, 7.10 feet with 2" aluminum cap marked "UNION COUNTY SURVEYOR SW RP".
A 5/8" x 30" rebar bears \$30" rebar bears

A 5/8" x 30" rebar bears N1°W, 20.43 feet with 2" aluminum cap marked "UNION COUNTY SURVEYOR NW RP".

I hereby certify that the above corner point was perpetuated as hereon described on April 28, 1992

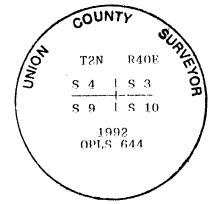

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination. The distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

PROFESSIONAL CLEVEYOR - <mark>Ó</mark>ŘEGON JULY 10, 1984 DUANE I. GRIFFITH

REGISTERED

UNION COMMY SURVEYOR Date Received Date Filed File No.

E-13 5513