
## UNION COUNTY CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was originally set by Rufus S. Moore under GLO contract no. 382, dated March 23, 1881. Surveyor General record states:

Set post for 1/4 section corner. From which A pine 34 ins. dia bears N 22°E, 50 lks. A pine 26 ins. dia bears N 28°W, 60 lks.

In 1904 road # 580 was surveyed on the East line of Section 10.

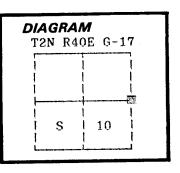

No record of subsequent monumentation found in Union County survey records.

## Description of corner evidence found:

I found no evidence of the original corner. I found the county road, a 24' gravel road, (60' between fences) now called County road number 50, (Thompson Road).

See Map of Survey Number 015-1992.

Description of monument and accessories I established to perpetuate the original location of this corner:


In the center of the existing county road and at the parenthetic distances between the north and south section corners, I set a 5/8" X 30" rebar with aluminum cap marked as shown, with the cap 5" below the road surface, marked as shown, from which;

A 5/8" x 30" rebar bears N42°E, 40.77 feet with 2" aluminum cap marked "NE RP".
A 5/8" x 30" rebar bears S62°E, 30.23 feet with 2" aluminum cap marked "SE RP".
A 15" ponderosa pine bears S48°W, 50.54 feet marked X BT A 16" ponderosa pine bears N79°W, 30.31 feet marked 1/4 S10 BT

Steel fence post 22.6 ft. east.

I hereby certify that the above corner point was perpetuated as hereon described on May 19, 1992.

Whitness: Pete Crabtree

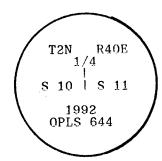

PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1984
DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination. The distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

	AEAOB CONFILA
Data Received	d
Date Filed	
3y	

5717

6 - 17