


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:  
Corner not previously established.

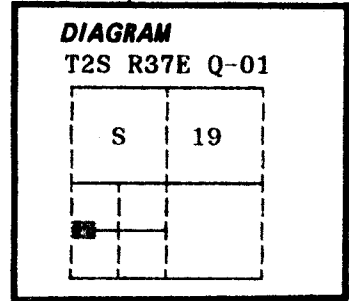

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Corner not previously established

See map of survey dated November, 1989.

Description of monument and accessories I established to perpetuate the

original location of this corner: At the proportionate position between the 1/4 corner North and the section corner South, on the Range line; I set a 2 1/2" x 30" aluminum pipe with aluminum cap marked as shown, 20 inches in the ground, from which:

New Bearing Trees;

A 12 inch diameter Ponderosa Pine bears N29°E, 68.57 feet marked X BT


A 12 inch diameter Ponderosa Pine bears S72°E, 58.05 feet marked S1/16 S19 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet North with land survey monument and property boundary signs attached.

Raised a mound of stone around monument, 5 ft. base to top of cap.

I hereby certify that the above corner point was perpetuated as hereon described on October 25, 1989.

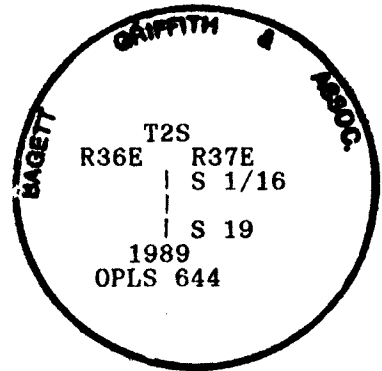

**REGISTERED  
PROFESSIONAL  
LAND SURVEYOR**

OREGON  
JULY 10, 1984  
**DUANE I. GRIFFITH**  
644

Witnesses: Rick Robinson and Jeff Petersen

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of.....

**UNION COUNTY  
SURVEYOR**

(COUNTY OFFICIAL)

(DEPUTY)

Form R6-7100-57 (9/71)

Date Received 12-27-89

Date Filed 12-27-89

By R. ROBINSON, DEPUTY

File No. 217 89R

GPO-791-311

Q-01