


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

This corner was not set in the original survey.

A survey was made by J.L.Curtis in 1890, number 126, recorded on page 271 of the old survey book. No description of the corners he set was recorded.

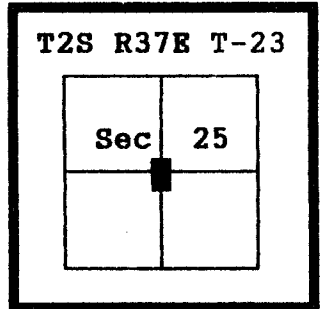

DIAGRAM

No record of subsequent monumentation found in Union County survey records
DESCRIPTION OF CORNER EVIDENCE FOUND:

NONE

See Union County Survey Number 027-1993.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

The position, determined by survey lands in a water course and could be washed out, at a point S 88°43'17"E, 8.00 feet, I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 22 inches in the ground, as a witness corner from which;

REFERENCE OBJECTS


- A 5/8" X 30" rebar bears N 43°E, 9.27 feet, with alumin cap marked NE RP.
- A 5/8" X 30" rebar bears S 62°E, 5.57 feet, with alumin cap marked SE RP.
- A 16" Douglas Fir bears S 81°W, 21.25 feet, marked C1/4 S25 BT
- A 9" White Fir bears N 64°W, 34.65 feet, marked X BT

Raised a small mound of stone around monument, to top of cap.

I hereby certify that the above corner point was perpetuated as hereon described on July 29, 1993.

Witness

Jim Bennett
Travis Foster

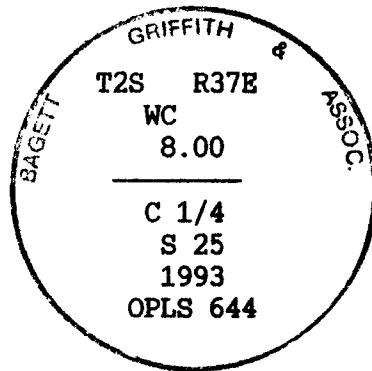

REGISTERED PROFESSIONAL LAND SURVEYOR

[Handwritten Signature]

OREGON JULY 19, 1964
DUANE I. GRIFFITH
644

UNION COUNTY SURVEYOR

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown, or center of cap. I attached a brass washer marked OPLS 644 to the BT blaze.

Date Received 8/9/93
Date Filed 8/9/93
By Gregory T. Blawie
File No. 030-1993R