Con. 15 opp 15-FT No of creek RECOVERY NOTES BOISE CASCADE CORP. PROPERTY CORNER INVESTIGATION 3 N R. 405 Put prece of blue sterped flagging on upper side of Road 75 ft E of conver (100 ft E of B.T.) G-5 LOCATION WN State DR Mer. Dist Elgin Forest <u>K Glass</u> Compartment or Tract LEGEND O Corner searched-no evidence 18 Corner accessory found rked by perm. m Corner DESCRIPTION OF FOUND CORNER SIZE: MATERIAL: CONDITION: HEIGHT ABOVE GROUND: MARKINGS: Rack 1390 DESCRIPTION OF FOUND ACCESSORIES BT FOUND but unable to Remember Pine 15 June Need Replaced It did Need Replaced Tam 121 din bear N81 W 24.451 dist. Ann 1214 Um (inn 1319 india) Lice Note: Indicate full investigative details on back of form and where cruise tay placed in reference to corner. PHOTO IDENTIFICATION 8-18-13 Line or 16 Exposure_ Symbol & date _Where filed fly How Identified PIN PONT Stat RL Memory, RECOVERED BY:___ TITLE: Forest to 29 \$20/85 DATE: ____ ÷.,

UNION COUNTY SURVEYOR Date Received 1-4-88 G - SDate Filed_1-7-88 BY G. LANGLITE, DEPUTY File No. 39-88R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Originally set by the subdivision of Township 3 North, Range 40 East by Herman Gradon in Contract Number 517, dated September 30, 1884. Surveyor General record states:

Set a basalt stone 14x10x7 ins. 9 ins in the ground for 1/4 Sec. Cor., marked 1/4 on W. face, from which: A pine 6 ins. in diam. bears S68°E, 10 lks. dist., marked 1/4 S BT. A tamarack 12 ins. in diam. bears N81°W, 37 lks. diat., marked 1/4 S BT.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 17" tamarack stump North 81° West, a distance of 24.4 feet, with visible scribe marks $^{1/4"}$ on an opened blaze.

From this stump, a stone 14"x10"x7" bears due East, a distance of 19.5 feet, with faint marks visible on upward face, disturbed and loose on the ground.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At record bearing and distance from the tamarack stump, I set a $1 \frac{1}{2}x30"$ iron pipe with $2\frac{1}{2}"$ brass cap marked as shown below, 25 inches in the ground, in a mound of stone 2 ft. diameter, from which:

A 6 inch White Fir bears North 16° East, a distance of 18.10 feet, marked 1/4 S8 BT. A 14 inch White Fir bears South 40° East, a distance of 15.35 feet, marked 1/4 S8 BT. An 8 inch Western Larch bears South 54° West, a distance of 21.10 feet, marked 1/4 S7 BT. A 7 inch White Fir bears North 63° West, a distance of 21.50 feet, marked 1/4 S7 BT.


I set a steel fence post 2 feet North of the monument and bury the stone along the North edge of the iron pipe. Corner falls approximately 30 feet North of a dry creek bed, and approximately 100 feet West and South of a gravel road.

I hereby certify that the corner was perpetuated on September 6, 2012.



Renewal Date: June 30, 2013

UNION COUNTY SURVEYOR
Date Received9/10/17
Date Filed9/10/17
Filed By R. RUBINGN, DAR - Y
File Number 036-2017 R

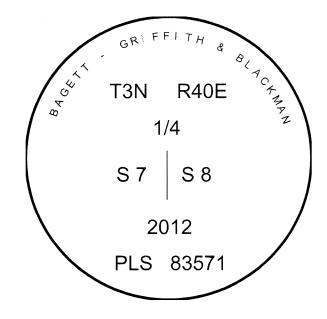

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination, the distances are to a 60d spike driven into the right side of the root crown of the new bearing trees. The spike in the Southeast bearing tree is on the left hand side. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

S 8

T3N R40EG-05