


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. N-25

History of original corner establishment:


In 1882, under GLO Contract No 451, Rufus S. Moore set a stone 16x12x7, from which an 8" Pine bears N21°W, 99 lks.; a 5" Pine bears N19°E, 118 lks.; a 34" Pine bears S13°E, 35 lks.; and a 24" Pine bears S22°W, 68 lks.

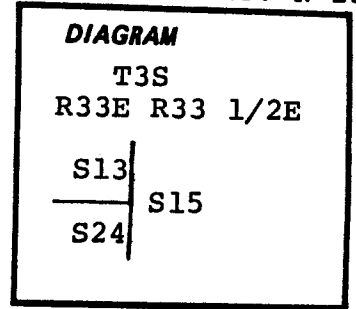

Description of corner evidence found:

Found BLM 3 1/4" brass cap on 2 1/2" iron pipe rising 6", stamped:
Found original stone along east side.

Bearing trees found:

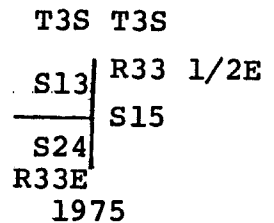

- A 7" Fir bears N78°W, 10.2 ft., scribing visible "T3S R33E S13 BT".
- A 5 1/2" Fir bears S51 1/2°W, 13.8 ft., dead standing, scribing visible "'X' BT".
- A 20" P. Pine bears S22°W, 45.2 ft. to center of stump, dead and down.
- A 21 1/2" P. Pine bears S13°E, 24.2 ft., dead standing, blaze healed.

Description of monument and accessories | established to perpetuate the original location of this corner:

New BT's:

- A 5 1/2" Fir bears S30°W, 2.0 ft., scribed T3S R33E S24 BT.

Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March, 1982. Set metal fence post 4 ft. north of corner.

Compass Declination: 19 1/2°E

Witness: G. Arrand

From the intersection of 2115-235 with 2115 westerly, go southeasterly and east 1.25 mi. on 2115 to where road turns to the north. Follow an old logging road southeasterly downhill to where it turns west. Follow clearing southeasterly 250 ft. Corner is 100 ft. easterly down the hill.

I hereby certify the above described corner monument and/or accessories was established as described on June 9, 1984.

UNION COUNTY SURVEYOR	
Date Received	<u>7-2-84</u>
Date Filed	<u>7-3-84</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>871-84R</u>

REGISTERED PROFESSIONAL LAND SURVEYOR	
<i>[Signature]</i>	
OREGON JULY 13, 1979 B. A. SUTTON 1848	

Office of..... County of.....
 State of..... I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

T. 3 S., R. 33 E., Willamette Meridian, Oregon

CHAINS

The following field notes describe the remonumentation of certain original corner points, township 3 south, range 33 east, Willamette Meridian, Oregon, as provided for in the General Special Instructions, Group Number 350, Oregon, dated May 3, 1957, "Investigation of Collateral or Physical Evidence of Corner Positions and Accessories Followed by Remonumentation of Corner Points, with New Accessories when Needed."

The remonumentation of original corner points was made at the request of the United States Forest Service, in conjunction with their Land Line Location Program.

The mean magnetic declination is 20° E.

East Boundary, T. 3 S., R. 33 E., Willamette Meridian, Oregon

(Remonumenting corners established by Rufus S. Moore, Deputy Surveyor, in 1882)

The 1/4 sec. cor. of sec. 25 only, on the E. bdy. of the Tp., monumented with the original basalt stone, 19 x 12 x 5 ins., firmly set 7 ins. in the ground, no marks visible, from which the original bearing trees:

- A fir, 25 ins. diam., bears S. 82° E., 55 lks. dist., with headed blaze.
- A pine, 28 ins. diam., bears N. 74° W., 29 lks. dist., with scribe marks 1/4 S BT visible on open blaze.

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.

T 3 S
R 33 E | R 33 1/2 E
1/4 S 25 |
1975

from which a new bearing tree

- A fir, 27 ins. diam., bears S. 34° W., 57 lks. dist., mkd. 1/4 S25 BT.

Deposit corner stone alongside iron post.

The cor. of secs. 13 and 24 only, on the E. bdy. of the Tp., monumented with the original basalt stone, 16 x 12 x 7 ins., firmly set 8 ins. in the ground, no marks visible, from which the remains of the original bearing trees:

- A root hole, bears N. 19° E., 118 lks. dist., with a down and decayed pine snag alongside, 10 ins. diam., with scribe marks R34E S18 visible on decayed blaze.
- A pine, 24 ins. diam., bears S. 13° E., 35 lks. dist., with healed blaze.

UNION COUNTY SURVEYOR

Date Received 3/15/13

Date Filed 3/15/13

By [Signature]

File No. 359-2013R

Remonumentation of Certain Original Corner Points,
T. 3 S., R. 33 E., Willamette Meridian, Oregon

CHAINS

A pine snag, 22 ins. diam., bears S. 22° W., 68 lks. dist., with scribe marks T3S R33E S24 visible on partially healed blaze.

A root hole, bears N. 21° W., 99 lks. dist., with a down and decayed pine snag alongside, 16 ins. diam., with scribe marks BT visible on decayed blaze.

At the corner point

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T 3 S	T 3 S
S 13	R 33½ E
S 24	S 15
R 33 E	
1975	

from which new bearing trees

A fir, 5 ins. diam., bears S. 51½° W., 21 lks. dist., mkd. X BT.

A fir, 7 ins. diam., bears N. 78½° W., 15 lks. dist., mkd. T3S R33E S13 BT.

Deposit corner stone alongside iron post.

The ¼ sec. cor. of sec. 13 only, on the E. bdy. of the Tp., monumented with the original basalt stone, 18 x 12 x 12 ins., firmly set 5 ins. in the ground, no marks visible, from which the remains of the original bearing trees:

A pine, 18 ins. diam., bears N. 57° E., 118 lks. dist., with healed blaze.

A pine stump, 8 ins. diam., bears N. 25½° W., 41 lks. dist., with scribe marks BT visible on decayed blaze. (Record, N. 23° W.)

At the corner point

Set an iron post, 28 ins. long, 2½ ins. diam., 2 ins. in the ground, to solid rock, in a mound of stone, 5 ft. base, to top, with brass cap mkd.

T 3 S	T 3 S
R 33 E	R 33½ E
¼ S 13	
1975	

from which new bearing trees

A juniper, 12 ins. diam., bears S. 28° W., 40 lks. dist., mkd. ¼ S13 BT.

A pine, 22 ins. diam., bears N. 58½° W., 115 lks. dist., mkd. ¼ S13 BT.

Deposit corner stone alongside iron post.

**UNION COUNTY
SURVEYOR**

Date Received 3/15/13

Date Filed 3/15/13

File No. 359-2013R