


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Z-21

History of original corner establishment:

Corner ESTABLISHED by W. B. Barr under GLO Contract No.355 dated June 14, 1880, and his record states:

Set stake 4 ft long 4 ins diam 18 ins in ground for Corner to Sec. 1 x 2 x 35 x 36 from which:
 Fir 24 in diam bears S4°W, 25 lks dist.
 Fir 10 in diam bears S65°E, 22 lks dist.
 Fir 8 in diam bears W, 22 lks dist.
 No other trees.

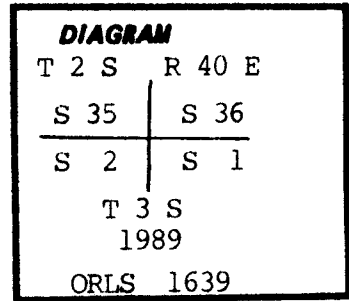

Corner RECOVERED by Henry Meldrum preliminary to his partial subdivision of township under GLO Contract No.450 dated June 11, 1882, and his record states: Corner Secs. 35,36,1 & 2 on S Boundary of Township which is a post 4 ft long 4 in square firmly set in ground marked T2SS36 on NE, R40ES1 on SE, T3SS2 on SW and S35 on NW face with 1 notch on E & 5 notches on W edges, from which: A fir 24 in diam bears S4°W, 25 lks dist mkd T3SR40ES2 BT. A fir 10 in diam bears S65°E, 22 lks dist mkd T3SR41ES1 BT. A fir 8 in diam bears W, 22 lks dist mkd BT

Description of corner evidence found:

None. Searched 10 man-hours total on 8-31-88, 9-01-88 and 7-16-89. Corner lost to wildfire. There are bug killed and rotten trees on small flat above steep ground.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position mid-way between reestablished 1/4 Corner 1/2 mile west and recovered 1/4 Corner 1/2 mile East...

Set a 2" x 30" aluminum pipe with 2 1/2" aluminum cap 24" in ground & projecting 6" out of ground with surrounding stone mound & placed 6' steel fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

Western larch 10" dia brs N47 1/4°E, 18.0' dist mkd T2SR40ES36 BT.
 White fir 12" dia brs S61°E, 16.4' dist mkd T3SR40ES1 BT.
 Spruce 10" dia brs S29°W, 21.1' dist mkd T3SR40ES2 BT.
 White fir 14" dia brs N83 1/2°W, 10.9' dist mkd T2SR40ES35 BT.

New bearing trees have a brass washer marked PLS 1639 nailed flush to face of blaze. Attached signs 54-3 & 54-9 & painted face of blaze & a 6' band of red around each bearing tree.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly established by me & witnessed by F.S. Munro on July 16, 1989.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of.....County..Surveyor..... County of.....Union.....
 State of.....Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL)

UNION COUNTY SURVEYOR (DEPUTY)
Date Received <u>3-12-90</u>
Date Filed <u>3-12-90</u>
By <u><i>[Signature]</i></u>
File No. <u>39-90R</u>

*GPO-591-971, 1988