


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by General Land Office Contract survey
 The original notes state:
 West on true line between sections 4 and 9.
 40.00 set a basalt stone 18 x 15 x 4", 12" in ground for $\frac{1}{4}$ section corner from which a;
 Pine 24" dia. bears N53°E, 32 lks dist. marked $\frac{1}{4}$ SBT
 Tamarack 18" dia. bears S27°E, 41 lks dist. marked $\frac{1}{4}$ SBT

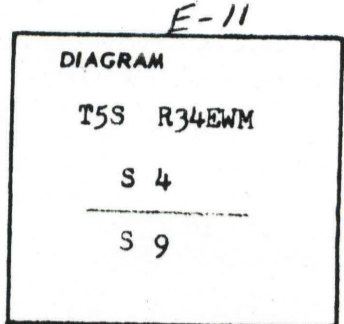

Description of corner evidence found:

At the corner found stone.
 In section 4, found pine 28" dia. with blaze and in good shape.
 In section 9, found down Tamarack log with scribe.


Description of monument and accessories I established to perpetuate the original location of this corner

At the position of the corner I set a 30" galvanized pipe with an eight inch plate welded to bottom and a bronze cap on top. The hole was back filled with stone and tamped soil.

I stamped the disk.

From the monument the original bearing tree was;
 Pine 28" dia. N53°E, 32 lks dist. marked $\frac{1}{4}$ SBT.
 I established the following new bearing tree;
 Red Fir 8" dia., S32°W at a distance of 2.9 ft. and scribed $\frac{1}{4}$ SBT;

The distance measured to center of respective trees on level.
 I placed bearing tree signs on both old and new bearing trees and painted stripe around trees. I placed a steel fence post with USFS sign 54-4 attached near the corner.

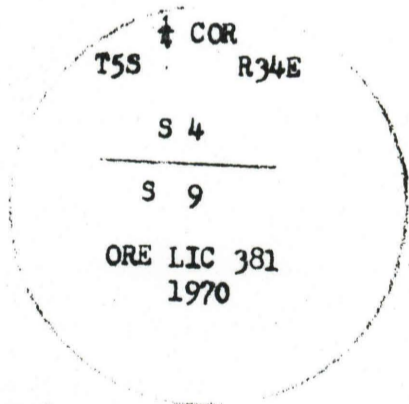

Office of County Surveyor County of Union
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 18 day of August, 1970, at 11 o'clock A.m., (signed)
County Surveyor by [Signature]
 (COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR	
Date Received	_____
Date Filed	_____
By	_____
File No.	<u>552-84R</u>