


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

G-13

History of original corner establishment:

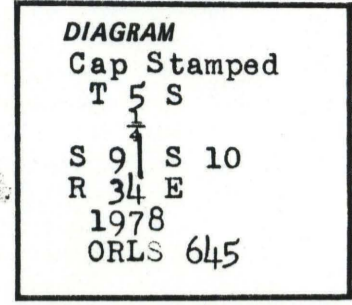

Corner was established in 1882, by Rufus S. Moore, under General Land Office Contract No. 451. Surveyor General's records state: Set a post 3 ft. long 3" square, 24" in ground for 1/4 sec. cor. marked 1/4 S on west face from which:
 A tamarack 20" dia. bears N 80 E, 10 lks. dist. marked 1/4 S BT.
 A fir 12" dia. bears S 78 W, 11 1/4 lks. dist. marked 1/4 S BT.

Description of corner evidence found:

At assumed corner location I found no trace of the wood post as previously described, however I did find a 14" fir stump and a log lying down hill from the stump, with a healed blaze. There was no evidence of the 20" tamarack as described in the GLO notes. I opened the blaze on the log and found the scribing 1/4 S BT.

Description of monument and accessories I established to perpetuate the original location of this corner:

As the evidence in the vicinity of the corner agrees with the GLO original record, at the location reconstructed from the position of the original bearing tree, I set a 2 1/2" brass cap on a 30" galv. iron pipe and being stamped as shown above, with a large mound of stone and dirt around and of which buried the monument.

New bearing trees:

A tamarack 6" dia. bears N 09 W, 29.0 feet scribed 1/4 S S 9 BT.
 A fir 6" dia bears N 78 E, 43.34 feet scribed 1/4 S S 10 BT.

I hereby certify the above corner monument was re-established as herein described in August 1978.

Witnesses: Leonard E. Green
Crew Chief
L. D. Shirley
Instrument Man

REGISTERED
PROFESSIONAL
LAND SURVEYOR

James H. Hambleton
8-21-78

OREGON
JULY 10, 1904
JAMES H. HAMBLETON
645

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....

..... by
 (COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY
SURVEYOR

Received _____
 Date Filed _____
 By _____
 File No. 557-84R