

Remonumentation of Certain Original Corner Points,
T. 5 S., R. 38 E., Willamette Meridian, Oregon

CHAINS

A fir, 7 ins. diam., bears N. 46° W., 18½ lks. dist., mkd. T5S R37E S12 BT.

Set a steel fence post alongside aluminum post.

The ¼ sec. cor. of secs. 7 and 12, on the W. bdy. of the Tp., determined at record bearing and distance from the remaining original bearing tree:

A fir, 15 ins. diam., bears N. 15° E., 14 lks. dist., with scribe mark S visible on partially opened blaze.

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, in a collar of stone, with aluminum cap mkd.

T 5 S
R 37 E R 38 E
¼
S 12 | S 7
1982

from which a new bearing tree

A spruce, 25 ins. diam., bears S. 37° W., 55 lks. dist., mkd. ¼ S12 BT.

Corner is located on E. bank of dry creek bed, course S.

Subdivisions, T. 5 S., R. 38 E.,
Willamette Meridian, Oregon

(Remonumenting corners established by William B. Barr,
U. S. Deputy Surveyor, in 1881)

The cor. of secs. 11, 12, 13, and 14, determined from the remains of the original bearing trees:

A root hole, bears N. 38° E., 32 lks. dist., with a down pine alongside, 10 ins. diam., with illegible scribe marks visible on opened and decayed blaze. (Record, N. 47° E.)

A decayed pine stump, 20 ins. diam., bears S. 48° E., 60 lks. dist., with scribe marks S BT visible on weathered and open blaze.

A decayed larch stump, 12 ins. diam., bears S. 51° W., 86 lks. dist., no marks visible.

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with aluminum cap mkd.

T 5 S R 38 E
S 11 | S 12
S 14 | S 13
1982

UNION COUNTY
SURVEYOR

Date received 2-2-84

Date filed 2-28-84

By G. LANGRISH DEPUTY

File No. 807-84R

PAGE 2 / 3

Remonumentation of Certain Original Corner Points,
T. 5 S., R. 38 E., Willamette Meridian, Oregon

UNION COUNTY SURVEYOR
Date Received <u>2-2-84</u>
Date Filed <u>2-28-84</u>
By <u>G. LANGLITZ, DEPUTY</u>
File No. <u>807-84 R</u>

PAGE 3/3

from which new bearing trees

A larch, 17 ins. diam., bears N. 64° E., 17 lks. dist., mkd. T58 R38E S12 BT.

A fir, 8 ins. diam., bears S. 22° E., 32 lks. dist., mkd. T58 R38E S13 BT.

A fir, 8 ins. diam., bears S. 25° W., 21½ lks. dist., mkd. T58 R38E S14 BT.

A fir, 8 ins. diam., bears N. 44° W., 27 lks. dist., mkd. T58 R38E S11 BT.

Set a steel fence post alongside aluminum post.

The ¼ sec. cor. of secs. 14 and 23, monumented with the original basalt stone, 12 x 12 x 5 ins., firmly set 8 ins. in the ground, no marks visible, from which the remains of the original bearing trees:

A fir, 13 ins. diam., bears N. 62° E., 23 lks. dist., with illegible scribe marks visible on opened blaze.

A decayed fir stump, 12 ins. diam., bears S. 65° E., 30 lks. dist., with weathered blaze, no marks visible.

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 21 ins. in the ground, in a collar of stone, with aluminum cap mkd.

T 5 S R 38 E
¼ S 14
S 23
1982

from which a new bearing tree

A fir, 10 ins. diam., bears S. 60° E., 15 lks. dist., mkd. ¼ S23 BT.

Deposit corner stone and set a steel fence post alongside aluminum post.

The ¼ sec. cor. of secs. 10 and 11, monumented with the original basalt stone, 16 x 14 x 6 ins., supported by a mound of stone, 3 ft. base, 2 ft. high, from which the original bearing trees:

A fir, 29 ins. diam., bears S. 55° E., 36 lks. dist., with scribe marks ¼ S visible on partially opened blaze.

A larch stump, 9 ins. diam., bears S. 40° W., 15 lks. dist., with a down larch alongside, with opened blaze, no marks visible. (Record, S. 44° W.)


At the corner point

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by W. B. Barr under GLO contract number 388 dated May 7, 1881. Surveyor General field notes state:
Marked basalt rock 14x10x4 for corner to sec. 11, 12, 13, 14, from which:
A Pine 4 in. diam bears N47°E 32 lks dist
A Pine 3 in. diam bears N47°W 19 lks dist
A Pine 24 in. diam bears S48°E 60 lks dist
A Tamarack 12 in. diam bears S51°W 86 lks dist

T 5 S R 38 E J-21

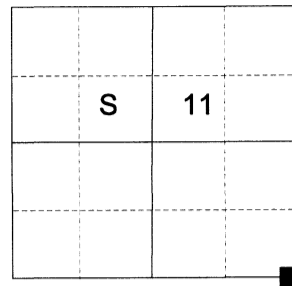

Corner perpetuated by Scott R. McIntyre under special instructions Group number 1000 for the remonumentation of certain original corners in Township 5 South, Range 38 East dated July 13, 1979. Record states: The cor. of secs. 11, 12, 13, and 14, determined from the remains of the original bearing trees.
A root hole, bears N. 38° E., 32 lks. dist. with a down pine alongside, 10 ins. diam., with illegible scribe marks visible on opened and decayed blaze.
A decayed pine stump, 20 ins. diam., bears S. 48° E., 60 lks. dist., with scribe marks 8 BT visible on weathered and open blaze.
A decayed larch stump, 12 ins. diam., bears S. 51° W., 86 lks. dist., no marks visible.

At the corner point set an aluminum post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with aluminum cap mkd. from which new bearing trees:
A Larch, 17 ins. diam., bears N. 64° E., 17 lks. dist., mkd. T5S R38E S12 BT.
A fir, 8 ins. diam., bears S. 22° E., 32 lks. dist., mkd. T5S R38E S13 BT.
A fir, 8 ins. diam., bears S. 25° W., 21 1/2 lks. dist., mkd. T5S R38E S14 BT.
A fir, 8 ins. diam., bears N. 44° W., 27 lks. dist., mkd. T5S R38E S11 BT.
Set a steel fence post alongside aluminum post.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 2 1/2" aluminum pipe with 3" aluminum "Department of the Interior, Bureau of Land Management" cap marked as shown below, 4" above ground, from which:

A heavily decayed log bears North 64° East a dist. of 11 ft., dead and down with partial scribes visible on a wood remnant.
A stump hole bears South 22° East a dist. of 21 ft.
A 9" Fir bears South 25° West a dist. of 14 ft., dead and down with scribes visible on partially healed blaze.
A 10" stump bears North 44° West, a dist. of 17.80 ft., with BT scribe visible on partially healed blaze.

SEE SURVEY 035-2020
DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:


From the aluminum pipe monument:

NEW BEARING OBJECTS:

An 8" Ponderosa Pine bears North 14° East a dist. of 19.90 ft., marked T5S R38E S12 BT.
An 11" Ponderosa Pine bears South 88° East a dist. of 18.00 ft., marked T5S R38E S13 BT.
A 6" Ponderosa Pine bears South 18° West a dist. of 29.15 ft., marked T5S R38E S14 BT.
A 24" Western Larch bears North 46° West a dist. of 33.85 ft., marked T5S R38E S11 BT.

A steel fence post is approx. 0.2 South of the aluminum cap.
I hereby certify that the corner was perpetuated on August 28, 2020.
Witness: Kyle A. Tucker

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

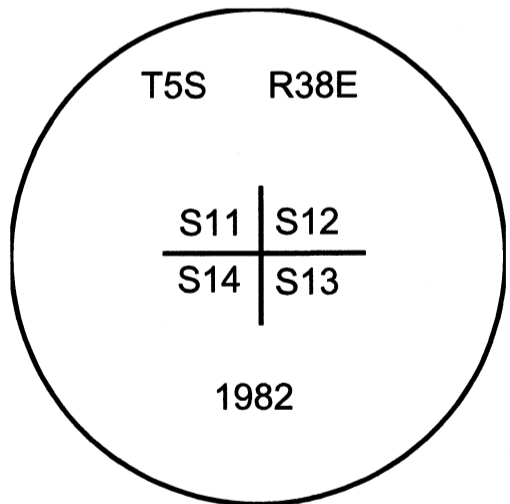

REGISTERED
PROFESSIONAL
LAND SURVEYOR

[Signature]
OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2021

UNION COUNTY
SURVEYOR
Date Received 10/12/2020
Date Filed 10/12/2020
Filed By *[Signature]*
File Number 077-2020R