

R623

Form 9600-9
(December 1979)
(formerly 9100-6)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

ORIGINAL.

23

FIELD NOTES
OF THE

REPOINTMENT OF CERTAIN ORIGINAL CORNER POINTS,

TOWNSHIP 5 SOUTH, RANGE 38 EAST,

[Blank lines for field notes]

Of the WILLAMETTE Meridian,
In the State of OREGON

EXECUTED BY

Scott R. McIntyre, Cadastral Surveyor

Under special instructions dated July 13, 19 79, approved July 17, 1979

which provided for the surveys included under U.S. Survey/Group
Number 1000, and assignment instructions dated July 30, 19 82

Survey commenced AUGUST 20, 19 82

Survey completed AUGUST 31, 19 82

UNION COUNTY
SURVEYOR

Date Received 2-2-84

Date Filed 2-28-84

By G. LANGLITZ, DEPUTY

File No. 812-84R

Remonumentation of Certain Original Corner Points,
T. 5 S., R. 38 E., Willamette Meridian, Oregon

A fir, 25 ins. diam., bears N. 37° W., 51 lks. dist., with healed blaze. (Record, N. 57° W.)

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 15 ins. in the ground, to solid rock, in a mound of stone, 3 ft. base, to top, with aluminum cap mkd.

T 5 S R 38 E
S 21 | S 22
S 20 | S 27
1982

from which new bearing trees

A fir, 6 ins. diam., bears N. 68° E., 29½ lks. dist., mkd. T58 R38E S22 BT.

A fir, 7 ins. diam., bears S. 47° E., 38 lks. dist., mkd. T58 R38E S27 BT.

A fir, 15 ins. diam., bears S. 26° W., 49 lks. dist., mkd. T58 R38E S28 BT.

Corner is located in a fence line, extending E. and W.

UNION COUNTY
SURVEYOR

Date Received 2-2-84

Date Filed 2-28-84

By G. LANGLITZ, DEPUTY

File No. 812-84 R

PAGE 2/2

The ¼ sec. cor. of secs. 21 and 22, monumented with the original basalt stone, 16 x 10 x 4 ins., firmly set 10 ins. in the ground, mkd. ¼ on W. face, from which the original bearing trees:

A fir, 22 ins. diam., bears N. 61½° E., 11 lks. dist., with healed blaze.

A fir, 20 ins. diam., bears N. 54½° W., 17 lks. dist., with healed blaze.

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, in a collar of stone, with aluminum cap mkd.

T 5 S R 38 E
¼
S 21 | S 22
1982

Deposit corner stone and set a steel fence post alongside aluminum post.

The ¼ sec. cor. of secs. 15 and 22, monumented with the original basalt stone, 12 x 10 x 6 ins., firmly set 7 ins. in the ground, mkd. ¼ on N. face, from which the remains of the original bearing trees:

A decayed pine stump, size indeterminate, bears S. 19° W., 27 lks. dist., with scribe marks ¼ S BT visible on open blaze.

A decayed fir snag, 15 ins. diam., bears N. 33° W., 9 lks. dist., with scribe marks ¼ S BT visible on open blaze.

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by William B. Barr, under GLO Contract No. 388, approved December 31, 1881.

Record States: Marked basalt rock 16x10x4 for ¼ sec. corner, from which:

- Fir, 20 in diam., bears N 61½° E, 11 lks. dist.
- Fir, 16 in diam., bears N 54½° W, 17 lks. dist.


Subsequent Monumentation

Corner was remonumented by Scott R. McIntyre, under BLM Group No. 1000, approved December 27, 1983.

Record States: The ¼ sec. cor. of secs. 21 and 22, monumented with the original basalt stone, 16x10x4 ins., firmly set 10 ins. in the ground, mkd. ¼ on the W. face, from which the original bearing trees:

- A fir, 22 ins. diam., bears N. 62½° E., 11 lks. dist., with healed blaze.
- A fir, 20 ins. diam., bears N. 54½° W., 17 lks. dist., with healed blaze.

At the corner point: Set an aluminum post, 28 ins. long, 2 ½ ins. diam., 22 ins. in the ground, in a collar of stone, with aluminum cap mkd. (as shown below)

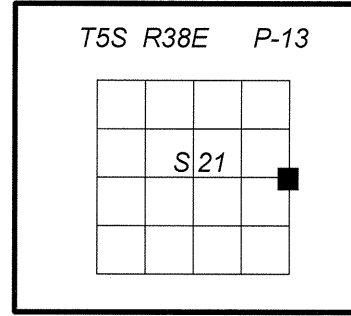


Description of corner evidence found:

Found 2½ ins. diam. alum. pipe, flush with ground, with standard BLM ¾ ins. diam. alum. cap, marked as shown:

From the recovered monument I find the original bearing trees:

- Fir remains, ±22 ins. diam., bears N. 61½° E., 27.7 ft. dist., no scribing visible, Land Survey Monument (54-9) sign attached, appears to have rolled downhill. (Record: 11 lks).
- A Douglas fir, 22 ins. diam., bears N. 54½° W., 17 lks. dist., alive with healed blaze.

Found guard post ±1.5 ft. NE'ly.

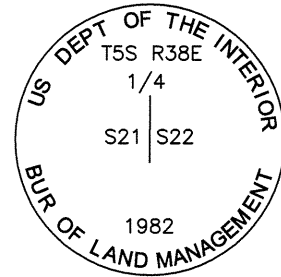

Description of monument and accessories I established to perpetuate original location of this corner:

New accessories:

- A 2 ins. XBO chiseled on exposed rock outcrop, 15 ft. x 6 ft. high, bears N. 50° E., 13.6 ft. dist.
- A white fir, 6 ins. diam., bears S. 74½° E., 24.4 ft. dist., mkd. X BT on double blaze.
- A ponderosa pine, 6 ins. diam., bears S. 84° W., 18.3 ft. dist., mkd. X BT on double blaze.

Set guard posts ±5 ft S'ly with Property Boundary (54-2) sign and ±5 ft N'ly with Property Boundary (54-2) and Land Survey Monument (54-9) signs.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position:

- Lat. 45°06'53.4" N
- Long. 118°03'17.5" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on June 19, 2014.

Witnesses: Brenda Johnson and Jon Howells

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Deceased

OREGON
JANUARY 18, 1994
RON C. WALTER
2648

Renewal Date: June 30, 2016

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
July 22, 1977
WILLIAM R. WELLS
1106

Renewal Date: June 30, 2016

**UNION COUNTY
SURVEYOR**

Date Received 2/25/15

Date Filed 2/25/15

By *[Signature]*

File No. 031-2015R

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.