
History of original corner establishment:


Not previously established.

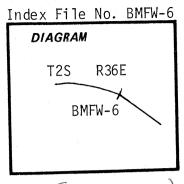

(SEE SURVEY 42-82)

Description of corner evidence found:

None.

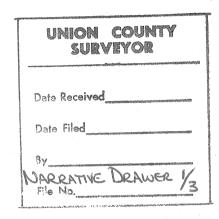

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest wayside determined by survey.

At surveyed point: Set 2 1/2"x30" galvanized pipe with brass cap Set pipe 24" in ground with mound of stone to cap.

BMFW 6 PLS 1099 1981

From which:

A Lodgepole Pine 6" dia. bears N77°W, 21.3 ft., scribed BMFW 6 BT. A Pond. Pine 22" dia. bears N 4°W, 66.4 ft., scribed BMFW 6 BT.

Attached brass washer stamped LS 1099 to foot blaze of BT's. Attached 54-3 and 54-4 signs to BT's and painted blazes and 6" band around BT's red. Attached 54-9 sign to metal post 5 ft. S.E. of corner.

Corner falls on small fill on north side of U.P.R.R. 50' from centerline and 20' north of fence. BMFW 6 is the beginning of the curve in the northerly R/W.

Compass Declination: 18 1/2°

I hereby certify the above described corner monument and/or accessories was established as described on December 14, 1981.

Witnesses: Rodger Orton

Gary Langlitz

PROFESSIONAL LAND SURVEYOR
Han L. Langlet
GARY L. LANGLITZ 1099


Office of	Surveyor		County of	Union		
- · · · · ·	Oregon	hu partifu tl	ant the within i	netrument was	filed in this	office
for record on the	ward L. Perry	TOBER		- 1 1 0		
Но	ward L. Perry	by	Jan 7	d. Longli	<u> </u>	
(0	COUNTY OFFICIAL)		0'	" VIDERUTY	5	

Form R6-7100-57 (9/71)

☆ GPO 799-509


History of original corner establishment:

Not previously established.

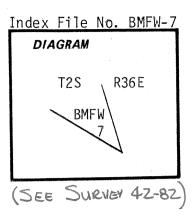

Description of corner evidence found:

None.

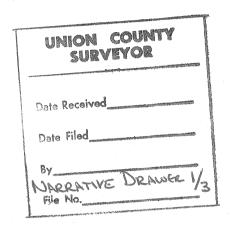

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest wayside determined by survey.

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap stamped:

Set pipe 24" in ground with stone to cap.

From which:

A Pond. Pine 12" dia. bears N  $79^{\circ}\text{E}$ , 121.3 ft., scribed BMFW 7 BT.

A Pond. Pine 16" dia. bears N 40°W, 126.0 ft., scribed BMFW 7 BT.

Attached brass washer stamped LS 1099 to foot blaze of BT's. Attached 54-3 and 54-4 signs to BT's. Painted blazes and 6" band around BT's red. Attached 54-2 and 54-9 signs to metal post 5 ft. N.W. of corner. Corner falls in large opening 6 ft. South of E-W fence and 50 ft. Northeast of centerline UPRR. This point is on the northerly line of the UPRR R/W.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on  $Dec.\ 14,\ 1981.$ 

Witnesses: Rodger Orton Gary Langlitz

Office of Surveyor	County of Union	
Oregon ,	bounds, and the short the within instrument was filed in this off	inn
for record on the4 day of	OCTOBER 19.82 Janglit	
Howard L. Perry	by Jan J. Langlit	
(COUNTY OFFICIAL)	OEPUTY)	

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Jay J Jangly
OBE GON
GARY L LANGUTZ


PLS 1099

1981

History of original corner establishment:

Not previously established


Index File No. BMFW-8WC

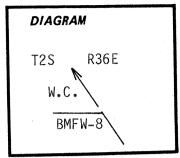

(SEE SURVEY 42-82)

Description of corner evidence found:

None

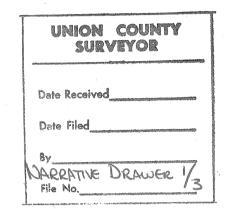

W.C.

BMFW8

PLS1099 1981

REFER TO SURVEY

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey. The location for BMFW-8 falls in channel of small creek 10 ft. wide therefore set

2 1/2"x30" galvanized pipe with brass cap stamped: True corner position is N16° 58' W, 50.00' of monument. For witness corner to BMFW-8 true location, set pipe 24" in ground with stones to cap from which:

A Ponderosa Pine 20" diameter bears N36°E, 85.5 ft. scribed

W.C. BMFW 8 BT.

An Engleman Spruce 18" dia. bears S23°E, 87.6 ft. scribed

WC BMFW 8 BT. Attached 54-3 and 54-4 signs to BT's. Attached brass washer stamped LS1099 to foot blaze of BT's. Painted blazes and 6" band around BT's. Attached 54-2 and 54-9 signs to metal post 5' S.E. of witness corner. Witness corner falls 50' south and 50' west of small creek course S.E. also 160 ft. south of N.W. pipeline gas line clearing.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 14, 1981.

Witnesses: Rodger Orton


Gary Langlitz



Surveyor	Union County of
State of Oregon	hereby certify that the within instrument was filed in this office
for record on the day of Howard L. Perry	OCTOBER, 19.82 by JOL J. Janes
(COUNTY OFFICIAL	DERUTY


History of original corner establishment:

Not previously established

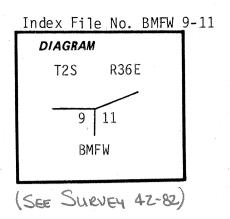

Description of corner evidence found:

None

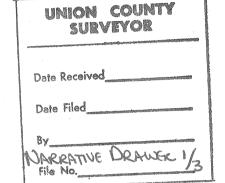

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey

At surveyed point:

Set 2 1/2"x30" galvanized pipe with brass cap attached 25" in the ground stamped:

From which:

A 10" Pond. Pine bears S38 1/2°W 30.1 ft.

scribed BMFW 9/11 BT

A 10" Doug. Fir bears N27 $^{\circ}$  W 35.3 ft.

scribed BMFW 9/11 BT

Attached 54-3 and 54-4 signs to BT's. Painted blazes and 6" red ring around BT's. Attached brass washers LS 1099 to foot blazes. Set metal post 5" westerly with 54-2 sign. Set metal post 5' easterly with 54-2 and 54-9 signs. Corner falls on slight east slope 300' south of power line.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 3, 1981.

Witnesses: Loren Huntsman Gary Langlitz

LAND SURVEYOR
OREGON OULY 22, 1977 GARY L. LANGLITZ 1099


REGISTERED

Office of Surveyor	County of Union
Oregon	the state of the s
for record on the	CTOBER
Howard L. Perry	by Jan & Sanglit
(COUNTY OFFICIAL)	O MEPUTO 3

History of original corner establishment:

Not previously established.


Index File No. BMFW-10

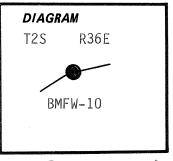

(SEE SURVEY 42-82)

Description of corner evidence found:

None

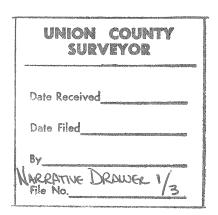

REGISTERED PROFESSIONAL

LAND SURVEYOR

1009

LANGLITZ

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey

At surveyed point set 2 1/2" x 30" galvanized pipe with brass cap attached 25" in the ground stamped:

From which:

A 16" Pond. Pine bears N82°W 39.1 ft., scribed "BMFW 10 BT" on a double blaze.

A 14" Tamarack bears N56 1/2° E 24.9 ft., scribed "BMFW 10 BT" on a double blaze. Attached 54-3 and 54-4 signs to BT's. Painted blazes and 6" red ring around BT's. Attached brass washers LS 1099 to foot blazes. Set metal post 5' easterly on wayside boundary with 54-2 and 54-9 sign. Set metal post 5' westerly on wayside boundary with 54-2 sign.

Corner falls on northeast slope 165' north of dirt road.

Compass Declination: 18 1/2° East.

I hereby certify the above described corner monument and/or accessories was established as described on December 3, 1981.

Witnesses: Gary Langlitz

Loren Huntsman

1	3MFW-	-10
0R	PLS	1099
	1981	


Surveyor	Union County of
State of Oregon / hereby certification	fy that the within instrument was filed in this office
for record on the	by Jam L. Langlet
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

☆ GPO---798-276

History of original corner establishment:

Not previously established

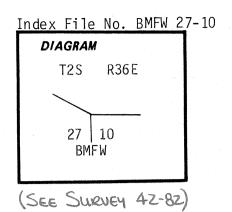

Description of corner evidence found:

None



Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey At surveyed point set 2 1/2"x30" galvanized pipe with brass cap stamped:

Set pipe 14" in ground with mound of stone and dirt to cap.

From which:

A Ponderosa Pine 12" dia. bears N21°E, 144.8 ft. scribed BMFW 27/10 BT.

A Ponderosa Pine 14" dia. bears N42°W, 136.1 ft. scribed BMFW 27/10 BT.


Attached brass washer stamped 1099 to foot blaze of both BT's. Attached 54-3 and 54-4 signs to both Bt's and painted blazes and 6" band around BT's red. Attached 54-2 and 54-9 signs to metal post 5' west of cor. and 54-2 sign to metal post 5' east of cor. Cor. falls on steep rocky south slope 250' south of old E-W road.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 11, 1981.

Witnesses: Rodger Orton Gary Langlitz

400	UNION COUNTY SURVEYOR
	Date Received
	Date Filed
. 1	
N	IARRATIVE DRAWER 1/3




REGISTERED
PROFESSIONAL
LAND SURVEYOR
Hain L. Langlit
OREGON JULY 22, 1977
JULY 22, 1977
GARY L. LANGLITZ
1029

Office of Surveyor	Union  hereby certify that the within instrument was filed in this office
Oregon	
State of /	hereby certify that the within instrument was filed in this office
for record on theA day of	OCTOBER 0, 1982
Howard L. Perry	OCTOBER 1982  by Law Langle  (DEPOTY)
(COUNTY OFFICIAL	(DEPUTY)


History of original corner establishment:

Not previously established

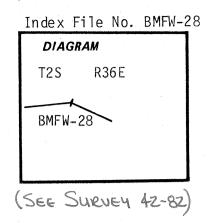

Description of corner evidence found:

None

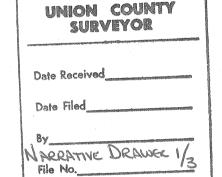

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey.

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap attached, 15" in the ground stamped:

BMFW28 PLS1099 1981

From which:

A 12" Douglas Fir bears N24°E 143.5 ft. scribed

BMFW 28 BT

A 14" Pond. Pine bears S70°W 69.8 ft. scribed

BMFW 28 BT

Attached 54-3 and 54-4 signs to BT's. Painted blazes and 6" red ring around BT's. Attached brass washers LS 1099 to foot blazes. Set metal post 5' westerly of monument with 54-2 and 54-9 signs. Set metal post 5' easterly of monument with 54-2 sign.

Corner falls on mostly bare south slope 50' north of dirt road.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 3, 1981.

Witnesses: Loren Huntsman

Gary Langlitz

Office of Surveyor	County of Union	
State of. Oregon	ereby certify that the within instrument was filed in this offi	ice
for record on the	)CTOBER	
(COUNTY OFFICIAL)	by John Johnson	

Form R6-7100-57 (9/71)

REGISTERED

AND SURVEYOR

OREGON


L. LANGLITZ

angli

PROFESSIONAL

History of original corner establishment:

Not previously established

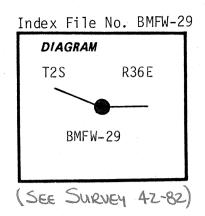

Description of corner evidence found:

None



Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey.

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap stamped: Set pipe 24" in ground with mound of stone to cap.

From which.

A Douglas Fir 14" dia. bears S72°E, 61.2 ft. scribed BMFW 29 BT

A Ponderosa Pine 10" dia. bears N3°E, 25.0 ft. scribed BMFW 29 BT.

Attached brass washer stamped LS 1099 to foot blaze of both BT's. Attached 54-3 and 54-4 signs to both BT's and painted blazes and 6" band around BT's red. Attached 54-2 and 54-9 signs to metal post 5' west of Cor. and 54-2 sign 5 ft. East of cor.

Cor. falls on SW slope 50 ft. east of bottom of draw course S.E. and 245 ft. south of east  $1/4\,$  S20 in old E-W road.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 11, 1981.

Witnesses: Rodger Orton

Witnesses: Rodger Orton Gary Langlitz

Date	Received		
Date	Filed	diverses appropriate dispersion and	(Silverson contraction of the
_			,
By	mandaran orang and manager in age	millionnimenenment	
NAR	JWT49	URAW	er 1/
File	No.		- 5

REGISTERED

PROFESSIONAL LAND SURVEYOR

GARY L. LANGLITZ

1099

BMFW 29 PLS 1099 1981


Office of Surveyor	County of Union
Oregon	
for record on the day of	CTO BEE
Howard L. Perry	by Jan J. Janglit
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

☆ GPO---798-276

History of original corner establishment:

Not previously established

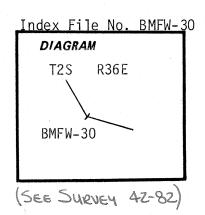

Description of corner evidence found:

None



Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey.

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap stamped:

Set pipe 16" in ground with mound of stone to cap.

From which:

A Douglas Fir 24" dia. bears S79°W 40.5 ft. scribed BMFW 30 BT.

A Ponderosa Pine 15" dia. bears N5°W 66.6 ft. scribed BMFW 30 BT.

Attached brass washer stamped LS1099 to foot blaze of both BT's. Attached 54-3 and 54-4 signs to both BT's and painted blazes and 6" band around BT's. Attached 54-2 and 54-9 signs to metal post 5 ft. N.W. of Cor. and 54-2 sign to metal post 5 ft. S.E. of Cor.

Cor. falls on S.W. slope in middle of large clearing.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 10, 1981.

> Rodger Orton Witnesses: Loren Huntsman

	UNION COUNTY SURVEYOR
Section of the safety metabolic productions of the safety	Date Received
PRESCRIPTURE DAMAGE	Date Filed
	By
N	PRRATIVE DRAWER 1/3
	File No.



PLS 1099


1981

PROFESSIONAL LAND SURVEYOR
OREGON JULY 22, 1977 GARY L. LANGLITZ 1090

Office of Surveyor County of Union	
State of Oregon / hereby certify that the within instrument was filed in	this office
for record on the day of OCTOBER 1982	
for record on the 4 day of OCTOBER 1982 Howard L. Perry by John Janglit (COUNTY OFFICIAL)	

History of original corner establishment:

Not previously established.

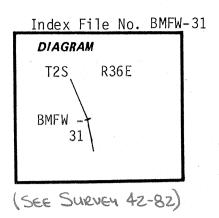

Description of corner evidence found:

None



Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey.

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap stamped: Set pipe 20" in ground to rock with mound of stone to cap.

From which:
A P. Pine 6" dia. bears S16°E, 19.4 ft. scribed BMFW 31 BT
A Douglas Fir 8" dia. bears N79°W, 12.6 ft. scribed BMFW 31 BT

Attached brass washer stamped LS1099 to foot blaze of both BT's. Attached 54--3 and 54--4 signs to both BT's and painted blazes and 6" ring around BT's red. Attached 54--2 and 54--9 signs to metal post 5 ft. S.E. of Cor. and 54--2 sign on metal post 5 ft. N.W. of Cor. Corner falls on steep west slope (rocky) 40 ft. west of top of N-S knoll at south end of knoll.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 10, 1981.

Witnesses: Rodger Orton Loren Huntsman

	UNION COUNTY SURVEYOR	
	Date Filed	Special property of the Control of t
8	BY	Consideration and a second sec

BMFW 31 \ PLS 1099 1981

REGISTERED
PROFESSIONAL
LAND SURVEYOR

JOLY 2. 1977
GARY L. LANGLITZ


1099

Office of Surveyor	County of Union
State of Oregon /	hereby certify that the within instrument was filed in this office
for record on the day of	OCTOBER 1982 by Jan J. Jangle
Howard L. Perry	by John of danals
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)


History of original corner establishment:

Not previously established

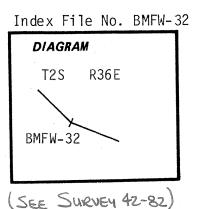

Description of corner evidence found:

None

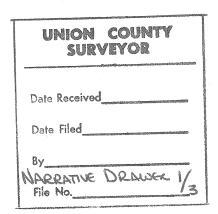

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey.

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap attached, stamped: Set pipe 16" in ground with mound of stone and dirt to cap. From which:

BMFW 32 PLS1099 1981

A Pond. Pine 8" dia. bears N48°W, 34.5 scribed BMFW 32 BT.

A Douglas Fir 10'' dia. bears  $S70^{\circ}W$ , 23.8 ft. scribed BMFW 32 BT.

Attached brass washer stamped LS1099 to foot blaze of both BT's. Attached 54-3 and 54-4 signs to both BT's and painted blazes and 6" band around both BT's red. Attached 54-2 and 54-9 signs to metal post 5' north of cor. and 54-2 sign on metal post 5' SE of Cor. Corner falls on steep rocky S.W. slope at beginning of draw, course S.W. 75' south of top edge of S.W. slope and approximately 200' south of E-W telephone line.

Compass Declination: 18 1/2° East


I hereby certify the above described corner monument and/or accessories was established as described on December 8, 1981.

Witnesses: Rodger Orton Gary Langlitz

PROFESSIONAL LAND SURVEYOR	
OREGON OREGON GARY L. LANGLITZ 1039	


Office of	Surveyor		County of	Union	
04-4	0regon	l harabu aartifu t	that the within	inetrument wa	e filed in this office
for record on	the day of	OCTOBER	9.87		A
	(COUNTY OFFICIAL	by	, rang	DEPUD	t

History of original corner establishment: Not previously established.

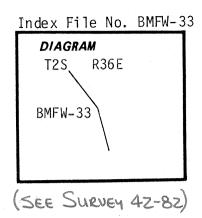

Description of corner evidence found:

None

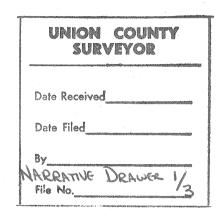

BMFW33

PLS 1099 1981

REFORTO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey

At surveyed point set 2 1/2"x30" galvanized pipe with brass cap attached stamped:

Set pipe 14" in ground with mound of dirt and stone to cap.

From which:

A Pond. Pine 24" dia. bears S65°E,61.0 Ft.

scribed BMFW 33 BT

A Pond. Pine 9" dia. bears N5°E, 43.6 Ft. scribed BMFW 33 BT

Attached brass washer stamped LS1099 to foot blaze of both BT's. Attached 54-3 and 54-4 signs to both BT's and painted blazes and 6" band around both BT's red. Attached 54-2 and 54-9 signs on metal post 5 ft. west of cor. and 54-2 sign on metal post 5 ft. east of cor. Cor falls 40 ft. south of top edge of steep rocky S.W. slope 100 ft. south of E-W telephone line.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on December 8, 1981.


Rodger Orton
Gary Langlitz nty of Union
nty or9111.911
within instrument was filed in this office
. , 1982.
un J. Langlit
O WDERUTY)

Form R6-7100-57 (9/71)

☆ GPO--798-276


History of original corner establishment:

Not previously established

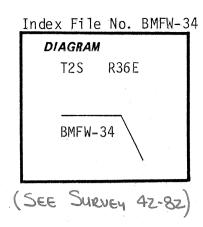

Description of corner evidence found:

None

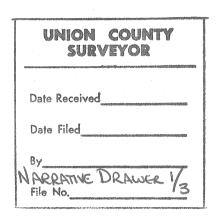

REFER TO SURVEY 42-82

Description of monument and accessories I established to perpetuate the original location of this corner:

Boundary of Blue Mtn. Forest Wayside determined by survey.

At surveyed point set 2 1/2" x 30" galvanized pipe with brass cap attached stamped:

BMFW 34 PLS 1099 1981

Set pipe  $6\,^{\prime\prime}$  in ground to solid rock with mound of stones to cap.

From which:

A Ponderosa Pine 13" dia. bears S51°E, 38.0 ft. scribed BMFW 34 BT  $\,$ 

A Douglas Fir 14" dia. bears N73°W, 100.7 ft. scribed BMFW 34 BT
Attached brass washer stamped LS1099 to foot blaze of both BT's. Attached 54-3 and 54-4 signs to both BT's. Painted blazes and 6" band around both BT's red. Attached 54-2 and 54-9 signs to metal post 5' West of corner and 54-2 sign to metal post 5' east of corner. Corner falls on steep rocky S.W. slope 179' east of N 1/4 S20

Compass Declination:  $18\ 1/2^\circ$  East I hereby certify the above described corner monument and/or accessories was established as described on December 8, 1981.

Witnesses: Rodger Orton Gary Langlitz

PROFESSIONAL LAND SURVEYOR
Joy L. Janglif OREGON JULY 2, 1977 GARY L. LANGLITZ
1099

Office of Surveyor	County of Union
. Oregon	
for record on the 4 day of OCTUBER.	by DERUTY
Howard L. Perry	by Jan & Smoth
(COUNTY OFFICIAL)	J V VIDERUTY

Form R6-7100-57 (9/71)