

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


J-15

History of original corner establishment:

Corner originally set by John W. Kimbrell in 1903. Corners set previously in 1899 and 1901 by Kimbrell were rejected by GLO. His contract was number 700.

Set a fir post properly marked from which:

- A 14" fir bears N83°W, 66 links (43.56 feet).
- A 14" fir bears S35°E, 36 links (23.76 feet).

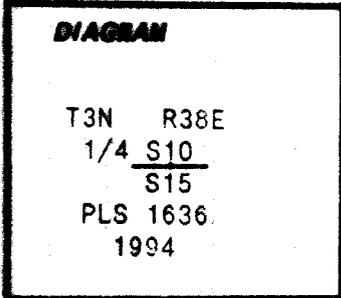

Description of corner evidence found:

Corner post is gone. A 29" Douglas-fir with a previously opened upper blaze, scribes "4S" visible, and a healed lower blaze, bears S35°E, 23.8 feet.

A Douglas-fir with 10 to 12 limbs growing straight up from a point about 3 feet from the ground bears N81°W, 43.6 feet. No blaze is apparent, but there are several very old axe trimmed limbs on this tree, which is leaning west. I also found evidence of the 1899 corner (the NW BT is live with a previously opened upper blaze with scribes chopped out) and the 1901 corner (the SW BT is a snag with healed blazes) at record position to the north.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the corner point as determined by reference to the original bearing trees, set a 2 1/2" x 30" aluminum pipe with a 3 1/4" aluminum cap attached, 28" into the ground. Built a small mound of stones around the pipe. The cap is marked as shown in the diagram above. From which:

- A 13" Douglas-fir bears N61°W, 10.7 feet marked "1/4S10 BT"
- A 24" Western Larch bears N42°E, 42.3 feet marked "1/4 S10 BT"
- A 15" Douglas-fir bears S59°E, 12.5 feet marked "1/4 S15 BT"
- A 11" Douglas-fir bears S42°W, 18.5 feet marked "1/4 S15 BT"

Each new bearing tree is scribed on double blazes and has a 3/4 inch brass washer, marked "PLS 1636", nailed flush to the lower blaze and a 54-3, Bearing Tree, sign nailed above the blaze and a 54-9, Land Survey Monument, sign nailed to the back.

I hereby certify the above corner point was perpetuated as hereon described on May 11, 1994.

Magnetic declination: 20°E.

NAD 1983 Geographic position (+ or - 2 to 5 meters)
 Latitude 45-44-47.25 N
 Longitude 118-02-44.72 W

Office of Union County Surveyor County of Union
 State of OR, I hereby certify that the within instrument was filed in this office
 for record on the 17 day of June, 1994
 _____ by _____
 (COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received 6/2/94
 Date Filed 6/17/94
 by Dennis L. Gaylord
 File No. 020-1994

REGISTERED PROFESSIONAL LAND SURVEYOR
Dennis L. Gaylord
OREGON
 JULY 14 1973
DENNIS L. GAYLORD
 1636
 RENEWS 6/30/95

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-15

History of original corner establishment:

1899 & 1901, John W. Kimbrell, U.S. Deputy Surveyor, working under G.L.O. contract No. 700, established this corner by setting a fir post and marking 2 Bearing trees (1899 corner was obliterated in 1901). THIS WORK IS REJECTED BY THE G.L.O.

1903, John W. Kimbrell obliterates his 1901 corner and established the corner by setting a fir post 3' long by 3" square, 24 inches in the ground, marked "1/4 S10" on N, "S15" S faces, from which;

14" fir bears N. 83° W., 66 links, marked "1/4 S10 BT".

14" fir bears S. 35° E., 36 links, marked "1/4 S15 BT".

The 1901 obliterated corner bears North, 450 links.

The 1899 obliterated corner bears N. 18° E., 152 links from the 1901 obliterated corner.

1994, Dennis L. Gaylord, PLS 1636, finds the bearing trees and remonuments the corner by setting a 2 1/2" diameter by 30" aluminum pipe, with 3 1/4" diameter aluminum cap, 28" in the ground and built small mound of stones around the pipe, and marked new BT's;

13" Douglas fir bears N. 61° W., 10.7 feet.

24" Western larch bears N. 42° E., 42.3 feet.

15" Douglas fir bears S. 59° E., 12.5 feet.

11" Douglas fir bears S. 42° W., 18.5 feet.

Description of corner evidence found:

I found a 2 1/2" diameter aluminum pipe, with a 3 1/4" diameter aluminum cap, projecting 2" out of the ground surrounded by a stone mound, from which;

24" Western larch bears N. 42° E., 42.3 feet, scribed "1/4 S10" "BT" on double blaze (1994).

15" Douglas fir bears S. 59° E., 12.5 feet, scribed "1/4 S15" "BT" on double blaze (1994).


29" Douglas fir bears S. 35° E., 23.8 feet, scribing "4S" visible on previously opened upper blaze and healed lower blaze (1903).

11" Douglas fir bears S. 42° W., 18.5 feet, scribed "1/4 S15" "BT" on double blaze (1994).

Douglas fir, with 10 to 12 limbs growing straight up 3' above ground, bears N. 81° W., 43.6 feet, with very old axe trimmed limbs but no apparent blaze (1903).

13" Douglas fir bears N. 61° W., 10.7 feet, scribed "1/4 S10" "BT" on double blaze (1994).

The 1994 BT's have a 3/4" diameter brass washer stamped "PLS 1636" nailed next to the "BT" scribing on the lower blaze.

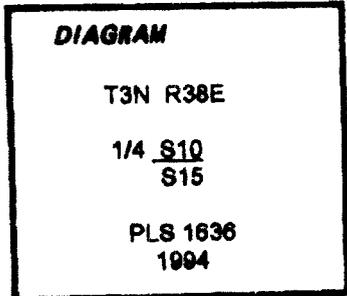

Description of monument and accessories I established to perpetuate the original location of this corner:

DATUM: NAD83(1991)
STATE PLANE COORDINATES: OREGON NORTH ZONE (meters)
Latitude: 45°44'47.11451" North
Longitude: 118°02'45.01792" West

Northing: 234010.693 meters Easting: 2690934.238 meters

Date: September 12, 1994

Witnessed by: Laurie Marin

Magnetic declination: 20° East

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David A. Schlaich

OREGON
JULY 16, 1987
DAVID A. SCHLAICH
2308

Renews 12-31-94

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

UNION COUNTY
SURVEYOR
Date Received 12/14/94
Date Filed 12/31/94
By [Signature]
File No. 100-1994R