

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

C-25


History of original corner establishment:

Corner ESTABLISHED by W.B.Barr under GLO contract No.355, dated June 14, 1880.

Surveyor General records state:

Set stake 4 ft long 4 in diam 18 in ground for 1/4 Sec Corner, from which:

A tamarack 15 in diam bears N25°E, 18 lks dist.
A tamarack 6 in diam bears S15°W, 40 lks dist.

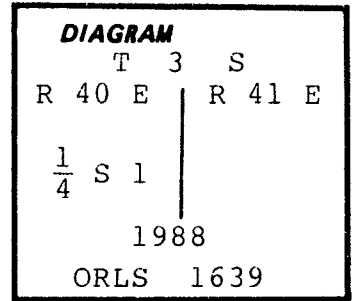

Description of corner evidence found:

Searched 6 man-hours total on 8-19-87 and 8-19-88 in swampy blow down area dominated by rotten tree remains - corner post or accessories not found and corner declared lost.

UNION COUNTY SURVEYOR	
Date Received	<u>6-8-89</u>
Date Filed	<u>6-9-89</u>
By	<u>G. LANGRISH, DEPUTY</u>
File No.	<u>113-89 R</u>

Description of monument and accessories I established to perpetuate the original location of this corner:

At proportioned position on line between NE & SE corners to Section 1...
Set 2½" aluminum cap on 2" x 30" aluminum pipe 24" in ground to bedrock & surrounded with mound of earth & stone. Set 6' steel fence post alongside corner with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:
A lodgepole pine 10" diam brs S71½°W, 6.0' dist mkd 1/4S1 BT.
A spruce 12" diam brs S11°W, 6.0' dist mkd 1/4S1 BT.

New bearing trees have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly REESTABLISHED to U.S.F.S. standards by me on August 19, 1988 and witnessed by Jim DeMastus.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Hanley

OREGON
JULY 14 1978
WILLIAM L. HANLEY
1988

Office of.....County Surveyor..... County of.....Union.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by

(COUNTY OFFICIAL)

(DEPUTY)