History of original corner establishment:

R-5

Set slate stone for corner to sections 19,20,29, and 30 from which:
A pine 18" in diam bears N69°W 54 lks.
A black pine 10" in diam bears S66°W 41 lks;
A black pine 10" in diam bears S42°E 35 lks;
A black pine 4" in diam bears N85°E 45 lks;
Slate stone 15°x9"x6"

	/	\sim		
DIAGRAM				
т4		rner r38ewm		
	S19	S20		
	S30	S29		

Description of corner evidence found:

At N69°N 54 lks the yellow pine was found at 28" in diam. with scribe A black pine 16" in diam was found at S42°E 35 lks dist with scribe.; The slate ro ck was found at the position of the corner.

Description of monument and accessories I established to perpetuate the original location of this corner

At the position of the corner I set a 2" Galvanized pipe with brass cap on top. to a depth of approx 24" and set the slate stone along side.;

From the position of the corner I set the following bearing trees.;

The yellow pine was in good condition and did not set one in section 19;

A doug fir 14" in diam bears N50°E 70.4 feet marked T4S R38E S20BT; A doug fir 11" in diam bears S25°E a dist. of 53.3 feet marked T4S R38E S29 BT; A doug fir 12" in diam bears S20°W 39.7 feet marked T4S R38E S30BT; (distance measured on surface of ground to BT scribe)

I stamped the disk.

	COL	R	
/	T4S	R38E	
	S1 9	9 S20	
	S30 ORE LIC	D S29 D 38	1)
	19	75	
		\checkmark	

Office of	Union UNION COUNTY
State of	tify that the within instrument was filed in this offisinveryor
(POUNTY OFFICIAL)	(DEPUTY) Dete Received
	Date Filed
	By
	File No. 535-84-R

Form R6-7100-57 (9/66)

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by W.B. Barr under GLO contract 388, dated May 7, 1881. Surveyor General field notes state:

Set Slate stone 15x9x6 for corner to sec 19, 20, 29 and 30 Pine 18 in diam bears N69°W, 54 lks. dist. Black Pine 12 in. diam. bears S66°W, 41 lks. dist. Black Pine 10 in. diam. bears S42°E, 35 lks. dist. Black Pine 4 in. diam. bears N85°E, 45 lks. dist.

Corner brought to county standard by James Voelz in 1975. Union County monumentation record 535-84R states:

At N69°W 54 lks the yellow pine was found at 28" in diam. with scribe. A black pine 16" diam was found at S42°E, 35 lks. dist with scribes. The slate rock was found at the position of the corner. At the position of the corner I set a 2" galvanized pipe with brass cap on top to a depth of approx 24" and set the slate stone alongside: From the position of the corner I set the following bearing trees: A doug fir 14" in diam bears N50°E, 70.4 feet marked T4S R38E S20 BT; A doug fir 11" in diam bears S25°E a dist. of 53.3 feet marked T4S R38E S29 BT. A doug fir 12" in diam bears S20°W 39.7 feet marked T4S R38E S30 BT.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 2 ½" iron pipe with 3" brass cap, marked as shown below, 5 inches above ground, from which: An 18" Fir stump bears North 50° East, a distance of 70 feet. A fir stump, size indeterminate, bears South 25° East, a distance of 53.3 feet, scribe marks visible on a partially healed blaze. A 24" Pine stump bears North 69° West, a distance of 34.1 feet, scribe marks visible.

A steel fencepost is driven alongside monument.


SEE SURVEY NUMBER 018-2016


DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER: From the iron pipe monument,

NEW BEARING OBJECTS: An 8" Lodgepole Pine bears North 49° East, a distance of 33.75 feet, marked T4SR38ES20 BT. A 6" Lodgepole Pine bears South 22° East, a distance of 3.50 feet, marked T4SR38ES29 BT. A 10" Douglas Fir bears South 41° West, a distance of 12.70 feet, marked T4SR38ES30 BT. A 6" Lodgepole Pine bears North 7° West, a distance of 28.55 feet, marked T4SR38ES19 BT.

I hereby certify that this monument was perpetuated June 14, 2016.



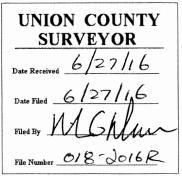

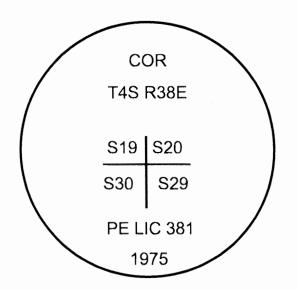

I use a steel tape and magnetic compass in the establishment of the new bearing trees. Magnetic declination used was 15° East. Distances to the new trees are to a spike in the root crown of the trees. Bearings are to a brass washer in the lower blaze marked OPLS 83571.

T 4 S R38E R-05

R-05