

R623

ORIGINAL.

Form 9600-9
(December 1979)
(formerly 9180-6)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

23

FIELD NOTES
OF THE

REMONUMENTATION OF CERTAIN ORIGINAL CORNER POINTS,

TOWNSHIP 5 SOUTH, RANGE 38 EAST,

UNION COUNTY
SURVEYOR

Date Received 2-2-84

Date Filed 2-28-84

By G. LADELITZ, DEPUTY

File No. 803-84 R

PAGE 1/2

Of the WILLAMETTE Meridian,
In the State of OREGON

EXECUTED BY

Scott R. McIntyre, Cadastral Surveyor

Under special instructions dated July 13, 19 79, approved July 17, 1979

_____, which provided for the surveys included under U.S. Survey/Group
Number 1000, and assignment instructions dated July 30, 19 82

Survey commenced August 20, 19 82

Survey completed August 31, 19 82

T. 5 S., R. 38 E., Willamette Meridian, Oregon

CHAINS

The following field notes describe the remonumentation of certain original corner points, township 5 south, range 38 east, Willamette Meridian, Oregon, as provided for in the Special Instructions, Group Number 1000, Oregon, dated July 13, 1979, "Investigation of Physical Evidence of Corner Positions and Accessories, Followed by Remonumentation of Corner Points, with New Accessories when Needed".

The remonumentation of original corner points was made at the request of the United States Forest Service, in conjunction with their Land Line Location Program.

The mean magnetic declination is 20° E.

West Boundary, T. 5 S., R. 38 E.,
Willamette Meridian, Oregon

(Remonumenting corners established by
Timothy W. Davenport, U. S. Deputy Surveyor, in 1863)

The cor. of secs. 19, 24, 25, and 30, on the W. bdy. of the Tp., determined at record distance from the remains of the original bearing trees:

A fir, 20 ins. diam., bears N. 50° E., 25 lks. dist., with healed blaze.

A saved fir stump, 18 ins. diam., bears N. 56° W., 41 lks. dist., no marks visible. (Record, N. 50° W.)

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 21 ins. in the ground, in a collar of stone, with aluminum cap mkd.

T 5 S
R 37 E R 38 E
S 24 | S 19
S 25 | S 30
1982

from which new bearing trees

A fir, 23 ins. diam., bears S. 48° E., 74 lks. dist., mkd. T58 R38E S30 BT.

A fir, 22 ins. diam., bears S. 39½° W., 71½ lks. dist., mkd. T58 R37E S25 BT.

A fir, 20 ins. diam., bears N. 71° W., 88½ lks. dist., mkd. T58 R37E S24 BT.

Set a steel fence post alongside aluminum post.

The cor. of secs. 13, 18, 19, and 24, on the W. bdy. of the Tp., determined at record bearing and distance from the remains of the original bearing trees:

A root hole, bears N. 40° E., 8 lks. dist., with a down and decayed pine alongside, 14 ins. diam., with illegible scribe marks visible on decayed blaze.

UNION COUNTY
SURVEYOR

Date Received 2-2-84

Date Filed 2-28-84

By G. LANGLITZ, DEPUTY

File No. 803-84R

PAGE 2/2

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by Timothy W. Davenport, under GLO Contract No. 102, approved January 12, 1864.

Record States: Set post corner to Secs. 19, 30, 24 + 25 From which:

- A White Fir 12 in dia bears N50°E 25 lks dist
- A White Fir 14 in dia bears S50°E 14 lks dist
- A Red Fir 9 in dia bears N50°W 41 lks dist
- A White Fir 6 in dia bears S70°W 40 lks dist

Subsequent Monumentation

Corner was rehabilitated by William B. Barr, under GLO Contract No. 388, approved December 31, 1881.

Record States: Corner agreeing with description. Stake. From which:

- Fir 14 in diam bears S50°E 14 lks dist
- Fir 12 in diam bears N50°E 25 lks dist
- Fir 9 in diam bears N50°W 41 lks dist
- Fir 6 in diam bears S70°W 40 lks dist

Corner was rehabilitated by William R. Gradon, under GLO Contract No. 445, approved December 5, 1882.

Record States: A post, marked T5S S19 on NE, R38E S30 on SE, R37E S25 on SW, and S24 on NW faces, with 2 notches on S and 4 notches on N edges, from which:

- A fir 12 ins diam bears N 50°E 25 lks dist, marked T7S R38E S19 BT. [sic]
- A fir 14 ins diam bears S50°E 14 lks dist, marked T7S R38E S30 BT. [sic]
- A fir 9 ins diam bears N50°W 41 lks dist, marked T7S R37E S24 BT. [sic]
- A fir 6 ins diam bears S70°W 40 lks dist, marked T7S R37E S25 BT. [sic]

Corner was remonumented by Scott R. McIntyre, under BLM Group Number 1000, approved December 27, 1983.

Record States: The cor. of secs. 19, 24, 25, and 30, on the W. bdy. of the Tp., determined at record distance from the remains of the original bearing trees:

- A fir, 20 ins. diam., bears N. 50° E., 25 lks. dist., with healed blaze.
- A sawed fir stump, 18 ins. diam., bears N. 56° W., 41 lks. dist., no marks visible. (Record. N. 50°W.)

At the corner point: Set an aluminum post, 28 ins. long, 2½ ins. diam., 21 ins. in the ground, in a collar of stone, with aluminum cap mkd. (as shown below) from which new bearing trees:

- A fir, 23 ins. diam., bears S. 48° E., 74 lks. dist., mkd. T5S R38E S30 BT.
- A fir, 22 ins. diam., bears S. 39½° W., 71½ lks. dist., mkd. T5S R37E S25 BT.
- A fir, 20 ins. diam., bears N. 71° W., 88½ lks. dist., mkd. T5S R37E S24 BT.

Description of corner evidence found:

Found 2½ ins. diam. alum. pipe, projecting 6 ins. above ground, with rock collar, and ¾ ins. diam. alum. cap, marked as shown:

From the recovered monument I find the original bearing tree remains:

- A fir, 20 ins. diam., dead & down, bears N. 50° E., 25 lks. dist., S 5 visible on decayed remains.
- Decayed cut stump, bears N. 56° W., 41 lks dist., no scribing visible.
- Fir remains, bears S. 50° E., 14 lks. dist. to stump hole, no scribing visible.

And accessories mkd. by McIntyre:

- A fir, 29 ins. diam., bears S. 48° E., 74 lks. dist., alive and healthy, with scribing visible on partially healed blaze.
- A fir, 28 ins. diam., bears S. 39½° W., 71½ lks. dist., alive and healthy, with healed blaze.
- A fir stump, 20 ins. diam., bears N. 71° W., 88½ lks. dist., with full scribe visible on dead and down remains.

Found Guard post ±2 ft. N'ly with Land Survey Monument (54-9) sign attached.

Description of monument and accessories I established to perpetuate original location of this corner:

New bearing trees:

- An Englemann spruce, 8 ins. diam., bears N. 8½° W., 5.7 ft. dist., marked T5S R37E S24 BT.
- A tamarack, 6 ins. diam., bears N. 78° W., 32.0 ft. dist., marked X BT on double blaze.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.



Auto C/A geographic position:

- Lat. 45°06'28.4" N
- Long. 118°06'58.7" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on June 12, 2014.

Witnesses: Kristina Powell and Brenda Johnson

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.

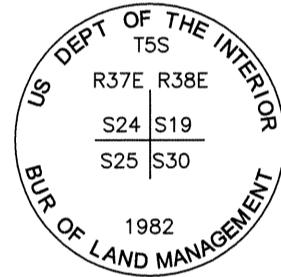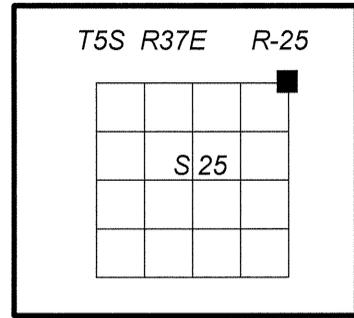

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Deceased

OREGON
JANUARY 18, 1994
RON C. WALTER
2648

Renewal Date: June 30, 2016

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
July 22, 1977
WILLIAM R. WELLS
1106

Renewal Date: June 30, 2016

**UNION COUNTY
SURVEYOR**

Date Received 2/25/15

Date Filed 2/25/15

By *William R. Wells*

File No. 013-2015R