

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**History of original corner establishment:**


Original corner set by Timothy W. Davenport, under GLO Contract No. 102, approved January 12, 1864.  
 Record States: Set post corner to Secs. 30, 31, 25 + 36, from which:  
 A Red Fir 8 ins dia bears N55°W  
 A Tamarack 12 ins dia bears S45°W  
 A Spruce 10 ins dia bears N70°E  
 A Spruce 14 ins dia bears S35°E

Note: No distances listed in original notes.

**Subsequent Monumentation**

Corner was remonumented by William B. Barr, under GLO Contract No. 388, approved December 31, 1881.  
 Record States: Corner destroyed. The stumps of bearing trees easily identified (the trees having been destroyed by persons engaged in mining) and agreeing with description.  
 Fir 8 ins dia bears N55°W  
 Tamarack 12 ins dia bears S43°W  
 Spruce 10 ins dia bears N70°E  
 Spruce 14 ins dia bears S35°E  
 Reestablished by marking basalt rock 12x10x10 and raising mound of rock as per instructions.

Corner rehabilitated by William R. Gradon, under GLO Contract No. 445, approved December 5, 1882.  
 Record States: A basalt rock 12x10x10 ins. marked with 1 notch on S and 5 notches on N edges. with mound of rock alongside.

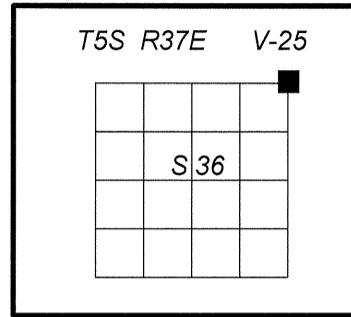

**Description of corner evidence found:**

Found 12x10x10 ins. basalt stone with 1 notch on South and 5 notches on North edges, and deteriorated stone mound 3 ft. east of stone.

**Description of monument and accessories I established to perpetuate original location of this corner:**

At the position of the undisturbed Barr corner stone, I set a standard USFS 2½ ins. diam. by 30 ins. long alum. pipe, 28 ins. in the ground, with ¾ ins. diam. alum cap, with rock collar, and clear DEEP-1 magnet at base, marked as shown:  
 From which:  
 An Englemann spruce, 7 ins. diam., bears N. 57° E., 20.8 ft. dist., mkd. X BT on double blaze, tree leans slightly N'ly.  
 A tamarack, 12 ins. diam., bears S. 50½° E., 28.6 ft. dist., mkd. T5S R38E S31 BT.  
 A lodgepole pine, 5 ins. diam., bears S. 9° W., 19.1 ft. dist., mkd. XBT.  
 An Englemann spruce, 8 ins. diam., bears N. 15½° W., 22.5 ft. dist., mkd. T5S R37E S25 BT.

Buried stone along south side of monument.

Set guard posts ±5 ft S'ly with Property Boundary (54-2) and Land Survey Monument (54-9) signs, and ±5 ft.W'ly with a Property Boundary (54-2) sign.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position:  
 Lat. 45°05'35.3" N  
 Long. 118°06'56.7" W

I hereby certify that the corner was monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 12, 2014.

Witnesses: Kristina Powell, Brenda Johnson and Justin Seal



REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

**Deceased**

OREGON  
JANUARY 18, 1994  
RON C. WALTER  
2648

Renewal Date: June 30, 2016

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
July 22, 1977  
WILLIAM R. WELLS  
1106

Renewal Date: June 30, 2016

**UNION COUNTY  
SURVEYOR**

---

Date Received 2/25/15  
 Date Filed 2/25/15  
 By *Neil G. Miller*  
 File No. 016-2015R

**NOTE:** See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.